

**TAUNTON RIVER BASIN
TAUNTON, MASSACHUSETTS**

**MILL RIVER DAM
MA 00813**

**PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM**

The original hardcopy version of this report
contains color photographs and/or drawings
For additional information on this report
please email

U.S. Army Corps of Engineers
New England District
Email: Library@nae02.usace.army.mil



**DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASS. 02154**

APRIL 1979

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

470-441

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER MA 00813	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Mill River Dam		5. TYPE OF REPORT & PERIOD COVERED INSPECTION REPORT
6. NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		7. PERFORMING ORG. REPORT NUMBER
8. AUTHOR(s) U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		9. CONTRACT OR GRANT NUMBER(s)
10. PERFORMING ORGANIZATION NAME AND ADDRESS		11. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
12. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 124 TRAPELO ROAD, WALTHAM, MA. 02254		13. REPORT DATE April 1979
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. NUMBER OF PAGES 45
		16. SECURITY CLASS. (of this report) UNCLASSIFIED
		17. DECLASSIFICATION/DOWNGRADING SCHEDULE
18. DISTRIBUTION STATEMENT (of this Report) APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
19. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
20. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
21. KEY WORDS (Continue on reverse side if necessary and identify by block number) DAMS, INSPECTION, DAM SAFETY, Taunton River Basin Taunton, Massachusetts Mill River-Tributary of the Taunton River		
22. ABSTRACT (Continue on reverse side if necessary and identify by block number) The dam consists of a 120 ft. long spillway which was originally built in 1932. There are deficiencies which must be corrected to assure the continued performance of the dam. Generally, the dam is in poor condition. It has been classified as small in size with a hazard potential of high. A test flood equal to one half the probable maximum flood. Recommendations were presented for constructing additional spillway capacity at both Morey's Bridge and Mill River dams. These recommendations have not been implemented.		



DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
424 TRAPELO ROAD
WALTHAM, MASSACHUSETTS 02154

REPLY TO
ATTENTION OF:
NEDED-E

SEP 29 1979

Honorable Edward J. King
Governor of the Commonwealth of
Massachusetts
State House
Boston, Massachusetts

Dear Governor King:

Inclosed is a copy of the Mill River Dam Phase I Inspection Report, which was prepared under the National Program for Inspection of Non-Federal Dams. The report is based upon a visual inspection, a review of past performance, and a preliminary hydrological analysis. A brief assessment is included at the beginning of the report.

The preliminary hydrologic analysis has indicated that the spillway capacity for the Mill River Dam would likely be exceeded by floods greater than 27 percent of one-half the Probable Maximum Flood (1/2 PMF), the test flood for spillway adequacy. Our screening criteria specifies that a dam of this class which does not have sufficient spillway capacity to discharge fifty (50) percent of the PMF, should be adjudged as having a seriously inadequate spillway and the dam assessed as unsafe, non-emergency, until more detailed studies prove otherwise or corrective measures are completed.

The term "unsafe" applied to a dam because of an inadequate spillway does not indicate the same degree of emergency as that term would if applied because of structural deficiency. It does indicate, however, that a severe storm may cause overtopping and possible failure of the dam, with significant damage and potential loss of life downstream.

It is recommended that within twelve months from the date of this report the owner of the dam engage the services of a professional or consulting engineer to determine by more sophisticated methods and procedures the magnitude of the spillway deficiency. Based on this determination, appropriate remedial mitigating measures should be designed and completed within 24 months of this date of notification. In the interim a detailed emergency operation plan and warning system should be promptly developed. During periods of unusually heavy precipitation, round-the-clock surveillance should be provided.

NEDED-E

Honorable Edward J. King

I have approved the report and support the findings and recommendations described in Section 7, with qualifications as noted above. I request that you keep me informed of the actions taken to implement these recommendations since this follow-up is an important part of the non-Federal Dam Inspection Program.

A copy of this report has been forwarded to the Department of Environmental Quality Engineering, the cooperating agency for the Commonwealth of Massachusetts. This report has also been furnished to the owner of the project, L&D Realty Trust, 437 Whittendon Street, Taunton, Massachusetts 02780, ATTN: Mr. David Olken.

Copies of this report will be made available to the public, upon request to this office, under the Freedom of Information Act, thirty days from the date of this letter.

I wish to take this opportunity to thank you and the Department of Environmental Quality Engineering for the cooperation extended in carrying out this program.

Sincerely,



MAX B. SCHEIDER

Colonel, Corps of Engineers
Division Engineer

MILL RIVER DAM

MA 00813

TAUNTON RIVER BASIN
TAUNTON, MASSACHUSETTS

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION
PROGRAM

NATIONAL DAM INSPECTION
PROGRAM

PHASE I INSPECTION REPORT

BRIEF ASSESSMENT

Identification No.: MA00813

Name of Dam: Mill River

Town: Taunton

County and State: Bristol County, Massachusetts

Stream: Mill River - Tributary of the Taunton River

Date of Inspection: November 30, 1978

Mill River Dam consists of a 120-foot long spillway which was originally built in 1832. The spillway is constructed of a rockfill base, faced with unreinforced concrete on the crest and downstream slope. A timber structure above the crest contains a wooden walkway and guideposts for six bays of stoplogs, 23 bays of abandoned slide gates, and a sluice gate. After a flood in March 1968, the upper portions of the slide gates and the sluice gate were cut off, and most of the operating mechanisms were removed. The only potentially operable gate is the sluice gate which is rusted and has not been used since 1970. Discharge is over the stoplogs and over the tops of the abandoned slide gates, which vary from elevation (El) 58.9 to 59.6. The effective length of the spillway is 91 feet. The outlet at the dam is a sluiceway through the spillway and is located 30 feet from the east abutment. Flow is through a 3-foot wide by 4-foot high opening controlled by a sluice gate. The invert is at El 49.3. The downstream channel has vertical, dry-stone masonry side walls. The channel is 120 feet wide at the dam, narrowing to 37 feet at 240 feet downstream.

There are deficiencies which must be corrected to assure the continued performance of this dam. This conclusion is based on the visual inspection of the site, a review of available data, and a review of operating and maintenance procedures. Generally, the dam is in poor condition.

MILL RIVER DAM

The following deficiencies were observed at the site: 23 inoperable slide gates, deterioration of the timber walkway over the spillway, leakage around and between the stoplogs and the abandoned slide gates, poor condition of the operating mechanism for the sluice gate, brush growth along the walls of the downstream channel, and collapsing stonework in the walls of the downstream channel and in the west wall upstream of the dam.

Based on the Corps of Engineers' guidelines, the dam has been classified as "small" and in the "high" hazard category. Accordingly, a test flood equal to one-half the probable maximum flood was used for this analysis. Hydraulic analyses indicate that the spillway (with all gates closed and stoplogs in place) can discharge 660 cfs with the pond at El 61.1, which is the east abutment of the spillway. A test flood outflow of 2,460 cfs (one-half the Probable Maximum Flood (PMF)) at El 63.1 will overtop the abutments by a maximum of 2 feet. The spillway (with all gates closed) can discharge 27 percent of the test flood outflow before the dam is overtopped. If all the gates were opened and all stoplogs removed by the time the pond level reached El 59.5, the spillway could discharge 2,460 cfs with the pond at El 60.8, which is 0.3 feet below the east abutment of the spillway. At the present time, the gates cannot be opened.


A report dated June 13, 1973, to the Commonwealth of Massachusetts, Department of Public Works, Division of Waterways on Morey's Bridge and Whittenton (Mill River) Dams in Taunton, Massachusetts was prepared by Metcalf & Eddy, Inc. Recommendations were presented for constructing additional spillway capacity at both Morey's Bridge and Whittenton (Mill River) Dams. These recommendations have not been implemented.

The spillway discharge capacity is not considered adequate. Therefore, further hydrologic and hydraulic studies are required to determine what alternative measures are necessary to significantly increase the discharge capabilities at the dam and reduce the overtopping potential. The Owner should employ the services of a qualified consultant to conduct these additional hydrologic/hydraulic studies, including an evaluation of the recommendations in the report by Metcalf & Eddy, Inc.

MILL RIVER DAM

The Owner should also accomplish the following: restore the abandoned slide gates to operating condition, repair the timber walkway over the spillway, restore the gate on the sluiceway to operating condition, remove brush growing on the sides of the downstream channel, and repair stonework in the walls of the downstream channel and in the west wall upstream of the dam. The Owner should also implement a regular program of inspection and maintenance and a warning system for the dam.

The remedial measures outlined above and in Section 7 should be implemented by the Owner within a period of one year after receipt of this Phase I Inspection Report. The Owner should immediately remove all of the abandoned slide gates on the spillway and lower the pond to El 55.1. The pond should be maintained at this level until the recommendations and remedial work have been completed. An alternative to these recommendations would be to drain the pond and remove the entire dam.

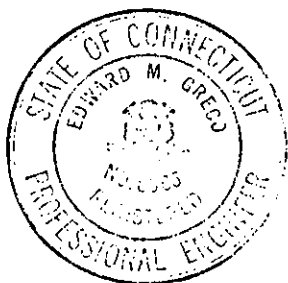

A handwritten signature in cursive script, reading "Edward M. Greco".

Edward M. Greco, P.E.
Project Manager
Metcalf & Eddy, Inc.

Connecticut Registration
No. 08365

Approved by:

A handwritten signature in cursive script, reading "Stephen L. Bishop".

Stephen L. Bishop, P.E.
Vice President
Metcalf & Eddy, Inc.

Massachusetts Registration
No. 19703



MILL RIVER DAM

This Phase I Inspection Report on Mill River Dam has been reviewed by the undersigned Review Board members. In our opinion, the reported findings, conclusions, and recommendations are consistent with the Recommended Guidelines for Safety Inspection of Dams, and with good engineering judgment and practice, and is hereby submitted for approval.

Joseph W. Finegan
JOSEPH W. FINEGAN, JR., MEMBER
Water Control Branch
Engineering Division

Joseph A. McElroy
JOSEPH A. MCELROY, MEMBER
Foundation & Materials Branch
Engineering Division

Carney M. Terzian
CARNEY M. TERZIAN, CHAIRMAN
Chief, Structural Section
Design Branch
Engineering Division

APPROVAL RECOMMENDED:

Joe B. Fryar
JOE B. FRYAR
Chief, Engineering Division

PREFACE

This report is prepared under guidance contained in Recommended Guidelines for Safety Inspection of Dams, for a Phase I Investigation. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigations, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test Flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general conditions and the downstream damage potential.

MILL RIVER DAM

TABLE OF CONTENTS

	<u>Page</u>
BRIEF ASSESSMENT	
PREFACE	
OVERVIEW PHOTO	iii
LOCATION MAP	iv
REPORT	
SECTION 1 - PROJECT INFORMATION	1
1.1 General	1
1.2 Description of Project	1
1.3 Pertinent Data	5
SECTION 2 - ENGINEERING DATA	10
2.1 General	10
2.2 Construction Records	10
2.3 Operating Records	10
2.4 Evaluation	10
SECTION 3 - VISUAL INSPECTION	11
3.1 Findings	11
3.2 Evaluation	13
SECTION 4 - OPERATING PROCEDURES	14
4.1 Procedures	14
4.2 Maintenance of Dam	14
4.3 Maintenance of Operating Facilities	14
4.4 Description of Any Warning System in Effect	14
4.5 Evaluation	14
SECTION 5 - HYDRAULIC/HYDROLOGIC	15
5.1 Evaluation of Features	15

MILL RIVER DAM

TABLE OF CONTENTS (Continued)


	<u>Page</u>
SECTION 6 - STRUCTURAL STABILITY	19
6.1 Evaluation of Structural Stability	19
SECTION 7 - ASSESSMENT, RECOMMENDATIONS, AND REMEDIAL MEASURES	21
7.1 Dam Assessment	21
7.2 Recommendations	22
7.3 Remedial Measures	22
7.4 Alternatives	23

APPENDIXES

APPENDIX A - PERIODIC INSPECTION CHECKLIST
APPENDIX B - PLANS OF DAM AND PREVIOUS INSPECTION REPORTS
APPENDIX C - PHOTOGRAPHS
APPENDIX D - HYDROLOGIC AND HYDRAULIC COMPUTATIONS
APPENDIX E - INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS

**OVERVIEW
MILL RIVER DAM
TAUNTON, MASSACHUSETTS**



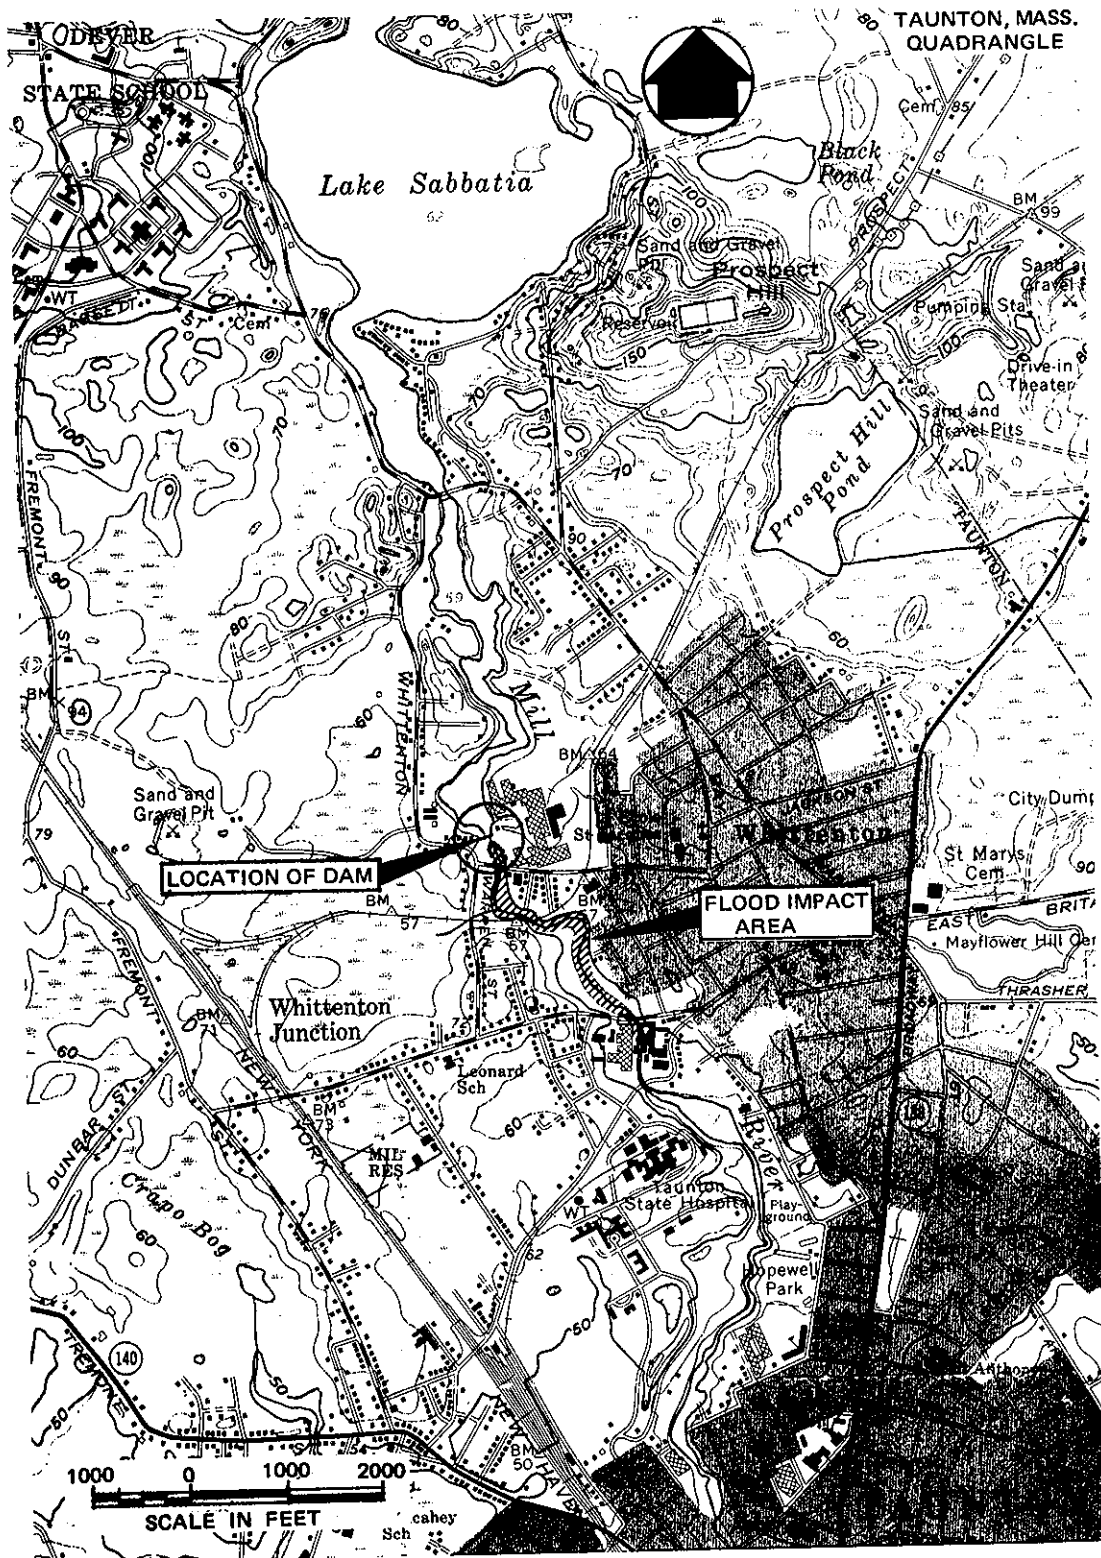

LOCATION MAP – MILL RIVER DAM

NATIONAL DAM INSPECTION
PROGRAM

PHASE I INSPECTION REPORT

MILL RIVER DAM

SECTION 1

PROJECT INFORMATION

1.1 General

a. Authority. Public Law 92-367, August 8, 1972, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a national program of dam inspection throughout the United States. The New England Division of the Corps of Engineers has been assigned the responsibility of supervising the inspection of dams within the New England Region. Metcalf & Eddy, Inc. has been retained by the New England Division to inspect and report on selected dams in the State of Massachusetts. Contract No. DACW 33-79-C-0016, dated November 28, 1978, has been assigned by the Corps of Engineers for this work.

b. Purpose:

- (1) Perform technical inspection and evaluation of non-Federal dams to identify conditions which threaten the public safety and thus permit correction in a timely manner by non-Federal interests.
- (2) Encourage and assist the States to initiate quickly effective dam safety programs for non-Federal dams.
- (3) Update, verify and complete the National Inventory of Dams.

1.2 Description of Project

a. Location. The dam is located on Mill River, a tributary of the Taunton River, in the City of Taunton, Bristol County, Massachusetts (see Location Map).

MILL RIVER DAM

Flow over the spillway enters a downstream channel with vertical, dry-stone masonry side walls and a natural streambed. The channel is 120 feet wide at the dam and decreases to 37 feet wide at about 240 feet downstream. The side walls are 11 to 12 feet high near the dam and 6 to 8 feet high farther downstream. The channel extends 365 feet downstream to Whittendon Street. Water flows beneath the roadway in two 7-foot by 19.5-foot box culverts, and then enters a natural stream channel.

- c. Size Classification. Mill River Dam is classified in the "small" category since it has a maximum height of 12 feet and a maximum storage capacity of 210 acre-feet.
- d. Hazard Classification. A large complex of mill buildings and a parking lot are located adjacent to and nearly level with the east abutment of the dam. About 275 feet downstream of the dam, there are two office buildings along the east side of the channel, and about 7 feet above the streambed. About 365 feet downstream of the dam, Whittendon Street, a two-lane roadway, crosses over Mill River on a 12-foot high embankment. Below Whittendon Street, the river flows through thickly developed areas along its east bank and through a complex of factory buildings 3,000 feet downstream of the dam.

Complete failure of the dam would produce a water level at about El 60 at the Whittendon Street Bridge (see flood impact area shown on the Location Map). Flooding of buildings along the east wall of the downstream channel could endanger more than a few lives and cause an excessive amount of property damage. The bridge embankment at Whittendon Street could mitigate the effects of the flood wave farther downstream. However, some flooding of the thickly developed areas downstream of the bridge could also occur. Accordingly, the dam has been placed in the "high" hazard potential category.

- e. Ownership. The dam is owned by L&O Realty Trust, 437 Whittendon Street, Taunton, Massachusetts 02780. Mr. David Olken, trustee,

MILL RIVER DAM

(telephone 617-823-0741) gave permission to enter the property and inspect the dam.

- f. Operators. The Owner is the operator of this dam.
- g. Purpose of Dam. Water impounded by the dam is used in the manufacturing process and for fire protection at textile mills located near the east abutment. Upstream of the dam, a 36-inch intake supplies 0.3 to 0.4 mgd to the mills. The intake also leads to two pumps which can be used for fire protection at the factories and to supplement the City supply for fire protection.
- h. Design and Construction History. Previous inspection reports state that the dam was originally constructed in 1832. A report dated 1973 indicates that the dam was rebuilt in 1882. According to the Owner, the dam was again reconstructed about 40 years ago and a plan dated 1935 (see Figure B-3) shows that some timbers were to be replaced on the gates and bracing. An inspection report dated 1959 (see page B-5) states that at that time, the dam was in fair condition but needed to be examined structurally and hydraulically.

In March, 1968, a flood occurred causing a 2.5-foot rise in the water level at the dam. Repairs were made in 1969-1970, including addition of rock and a concrete slab on the downstream face of the dam. The tops of the slide gates and sluice gate were cut off to maintain a lower water level. Since that time, Mill River Dam has functioned only as an ungated spillway, and the pond level is controlled by operating gates at Morey's Bridge Dam located upstream. Discharges under normal conditions are into Mill River from Morey's Bridge Dam.

In July, 1970, the dam was again inspected and found to be in fair condition. Gates were leaking and severe seepage was occurring at the downstream toe (see page B-4). The Massachusetts Division of Waterways was authorized to study the feasibility of reconstructing

MILL RIVER DAM

both Mill River (Whittendon) and Morey's Bridge Dams. Hydraulic and stability analyses were presented in a report by Metcalf & Eddy, Inc., dated June 13, 1973. It was recommended that all gates be restored and a new spillway be constructed at Mill River (Whittendon) Dam. These recommendations were never implemented.

- i. Normal Operating Procedure. There are no operating procedures at this dam. The water level in the pond can be controlled by operating gates at Morey's Bridge Dam located about 1 mile upstream. Personnel from L&O Realty Trust reportedly observe the water level daily upstream of Morey's Bridge Dam and operate the gates as necessary to prevent flooding of homes around Lake Sabbatia.

1.3 Pertinent Data

- a. Drainage Area. The approximately 26,560-acre (41.4 square mile) drainage area includes the drainage areas of the Canoe River, Mulberry Brook and Snake River. There are nine dams plus three other control points for drainage in the watershed, as indicated on the map of the drainage area (see Figure D-1).

The land in the watershed is gently rolling and mostly wooded. There is light residential and commercial development with local areas of moderate development, such as around Lake Sabbatia and around the pond upstream of Mill River Dam. There is also a large area of swamp known as Hock Mock Swamp in Taunton and a series of cranberry bogs downstream of Harcourt Reservoir in Easton.

- b. Discharge. Normal discharge is over the tops of abandoned slide gates, a sluice gate and stoplogs mounted in 30 bays on the crest of the spillway. The full length of the spillway is 120 feet, and the combined lengths of the bays is 91 feet. The crest of the spillway varies from El 55.1 to 58.2, and the top of the gates and stoplogs varies from El 58.9 to 59.6.

Water flows down a 1:1 to 2:1 slope on the downstream face of the spillway which is

covered with concrete. The downstream channel has a natural streambed with vertical, dry-stone masonry walls 6 to 11 feet high. The channel is 120 feet wide at the spillway and narrows to 37 feet wide at about 240 feet downstream. At about 365 feet downstream, flow passes through two 7-foot by 19.5-foot box culverts beneath Whittendon Street. The inverts of the culverts are at El 46.0, indicating the streambed slopes at a gradient of 1 percent.

The spillway (with all gates closed and stoplogs in place) can discharge an estimated 660 cfs with the water surface at El 61.1 which is the low point on the abutment of the spillway. The outflow test flood (one-half PMF) is 2,460 cfs at El 63.1. The spillway can discharge 27 percent of the Test Flood outflow before the dam is overtopped. If all gates were open and all stoplogs removed by the time the pond level reached El 59.5, the spillway could discharge 2,460 cfs with the pond at El 60.8 which is 0.3 feet below the east abutment of the spillway. At the present time, the gates cannot be opened.

The maximum flood level at the dam is unknown. In January 1979, the dam was not overtopped since the Owner removed boards from the tops of the abandoned slide gates in anticipation of heavy rainfall. A report dated 1973 states that during the March 1968 storm, the water level of the pond was at El 61.4. The discharge at that time is unknown, however, if all the gates were open and the stoplogs removed, the discharge is estimated to have been about 2,900 cfs.

- c. Elevation (feet above Mean Sea Level (MSL)).
A benchmark was established at El 61.09 on the east abutment of the dam. This elevation was shown on a drawing of the dam dated February, 1973.

- (1) Top dam: 61.1 east abutment of spillway
61.8 west abutment of spillway
- (2) Test flood pool: 63.1

MILL RIVER DAM

- (3) Design surcharge (original design):
Unknown
- (4) Full flood control pool: Not Applicable
(N/A)
- (5) Recreation pool: N/A
- (6) Spillway crest: 58.9 to 59.6 top of
stoplogs and gates; 55.1 to 58.2 concrete
crest
- (7) Upstream portal invert diversion tunnel:
N/A
- (8) Streambed at centerline of dam: 49.0
- (9) Maximum tailwater: 48.6 water surface
downstream of dam

d. Reservoir

- (1) Length of maximum pool: 4,100 feet
- (2) Length of recreation pool: N/A
- (3) Length of flood control pool: N/A

e. Storage (acre-feet)

- (1) Test flood surcharge (Net): 94 at El
63.1
- (2) Top of dam (El 61.1): 160
- (3) Flood control pool: N/A
- (4) Recreation pool: N/A
- (5) Spillway crest (El 58.9): 115 (with stop-
logs/gates)

f. Reservoir Surface (acres)

- *(1) Top dam: 23

*Based on the assumption that the surface area will not significantly increase with changes in reservoir elevation from 58.9 to 61.1.

MILL RIVER DAM

- * (2) Maximum pool: 23
- (3) Flood control pool: N/A
- (4) Recreation pool: N/A
- (5) Spillway crest: 23

g. Dam (dam consists of a spillway)

- (1) Type: Spillway made of rockfill base faced with concrete on crest and downstream slope
- (2) Length: 120 feet
- (3) Height: 12 feet to top of abutment
- (4) Top width: 2 feet - concrete crest
- (5) Side slopes: 1:1 to 2:1, upstream to downstream
- (6) Zoning: Unknown
- (7) Impervious core: Unknown
- (8) Cutoff: Unknown
- (9) Grout curtain: Unknown

i. Spillway

- (1) Type: 30 bays of stoplogs and gates mounted on rockfill and concrete base.
- (2) Length of weir (effective length): 91 feet
- (3) Crest elevation: 58.9 to 59.6 top of stoplogs/gates; 55.1 to 58.2 concrete crest
- (4) Gates: 23, one may be operable
- (5) Upstream channel: Vertical, dry-stone masonry training walls about 12 feet high

*Based on the assumption that the surface area will not significantly increase with changes in reservoir elevation from 58.9 to 61.1.

MILL RIVER DAM

- (6) Downstream channel: Vertical, dry-stone masonry side walls 6 to 11 feet high. Width of channel narrows from 120 feet at dam to about 37 feet at 240 feet downstream.
- (7) General: Whittendon Street Bridge crosses the discharge channel 365 feet downstream of the dam. Flow is through two 7-foot by 19.5-foot box culvert openings with inverts at El 46.0. Top of the street embankment is at about El 58.4.
- j. Regulating Outlets. The regulating outlet is a 3-foot wide sluiceway through the spillway, located in the eighth bay from the east abutment. The invert of the sluiceway is at El 49.3. Flow is through a 3-foot by 4-foot opening controlled by a wooden sluice gate. A rack and pinion mechanism is mounted to the wooden framework over the spillway. The timbers are deteriorating, the mechanism is rusted, and the gate has not been operated since about 1970.

MILL RIVER DAM

SECTION 2

ENGINEERING DATA

- 2.1 General. A drawing dated September 1935 is available from the Bristol County Commissioners Office and shows proposed repair of timbers on the dam (see Figure B-3). A report on hydraulic and stability analyses conducted for Mill River (Whittendon) Dam was prepared by Metcalf & Eddy, Inc. The report is dated June 1973 and copies are available from the Owner and from Metcalf & Eddy, Inc. No other plans, specifications, or computations are available from the Owner, State, or County agencies relative to the design, construction, or repair of this dam.

We acknowledge the assistance and cooperation of personnel from the Massachusetts Division of Waterways, the Massachusetts Department of Public Works, and Mr. David Olken of L&O Realty Trust.

- 2.2 Construction Records. The only construction records are the data referred to in Section 2.1. There are no as-built drawings for the dam.
- 2.3 Operating Records. No operating records are available, and there is no daily record kept of the elevation of the pool or amount of rainfall at the dam.
- 2.4 Evaluation
- a. Availability. There is limited engineering data available.
 - b. Adequacy. The lack of detailed structural and construction data did not allow for a definitive review. Therefore, the evaluation of the adequacy of this dam is based on review of available reports and drawings, visual inspection, past performance history, and engineering judgment.
 - c. Validity. Comparison of the available drawings with the field survey conducted during the Phase I inspection indicates that the available information is valid.

MILL RIVER DAM

SECTION 3
VISUAL INSPECTION

3.1 Findings

- a. General. The Phase I Inspection of the dam on Mill River was performed on November 30, 1978. A copy of the inspection checklist is in Appendix A. Previous inspections were conducted for the Bristol County Commissioners in August 1959 and July 1970. Copies of these reports are included in Appendix B. A report on the hydraulic and structural characteristics of the dam was prepared by Metcalf & Eddy, Inc. in 1973.
- b. Dam. The dam consists of a spillway with vertical, dry-stone masonry abutments. The spillway is constructed of a rockfill base covered with unreinforced concrete on the crest and downstream slope. A timber walkway above the crest contains guideposts for 23 bays of abandoned slide gates, one bay containing a sluice gate and six bays of stoplogs.

The dam is in poor condition. Seepage at the toe could not be determined due to water flowing over the crest of the spillway. The most obvious deficiencies at the site are the deterioration of the timber walkway over the spillway and the inoperable condition of the 23 abandoned slide gates. The timbers in the walkway are rotting, and at least one timber is missing. The walkway, which provides access to the stoplogs, slide gates, and sluice gate, is only marginally safe to walk on. Due to the deterioration of the timber, some leakage was observed around the guideposts of some bays. Leakage is also occurring between some stoplogs and between the boards of some slide gates. There are no hooks, eye bolts, or other means of removing the stoplogs or boards of the slide gates. The concrete on the crest and downstream slope of the spillway is pitted and eroded. Also, stonework is missing from a section of the west training wall upstream of the dam.

MILL RIVER DAM

- c. Appurtenant Structures. A sluiceway located in the eighth bay from the east abutment serves as the outlet for the dam. Flow is through a 3-foot by 4-foot opening controlled by a wooden sluice gate. A rack and pinion mechanism is attached to the gate and mounted on the overhead walkway. The operating mechanism is rusty and the timbers where the mechanism is mounted are rotting. The slide gate has not been used for at least eight years, and may not be operable. Leakage is occurring from the guideposts on the sides of the slide gate.
- d. Reservoir Area. The area around the impoundment of the dam is moderately developed with about 20 residences. There is also a complex of factories at the east abutment of the dam. It is possible that some future development could occur. The land is wooded or grassed, with slopes varying from 3 to 30 percent.
- e. Downstream Channel. Discharge from the spillway enters a downstream channel which extends for about 365 feet to Whittendon Street. The channel has vertical dry-stone masonry side walls and a natural streambed. The width of the channel decreases from about 120 feet at the dam to 37 feet at about 240 feet downstream. Beneath Whittendon Street, the river flows through two 7-foot by 19.5-foot box culverts. Downstream, the river flows in a natural streambed.

Brush is growing along both sides of the downstream channel. Some brush is rooted into the tops of the side walls, and a few trees are overhanging the west side of the channel. Brush is also growing from the base of both side walls and partially out into the floor of the channel.

Stonework is missing from both side walls of the channel, and some sections of the west wall have partially collapsed. One section, about 60 feet downstream of the dam on the west wall, has completely collapsed.

There is no significant amount of debris in the floor of the downstream channel.

MILL RIVER DAM

- 3.2 Evaluation. The above findings indicate that the dam is in poor condition and that there are several deficiencies which require attention. It is evident that the dam is not maintained. Recommended measures to improve these conditions are stated in Section 7.3.

SECTION 4

OPERATING PROCEDURES

- 4.1 Procedures. There are no operating procedures at this dam. The sluice gate has not been operated for at least eight years, and there is no means for removing the stoplogs or for operating the abandoned slide gates. The water level in the pond can only be controlled by operating gates at Morey's Bridge Dam, located about 1 mile upstream.
- 4.2 Maintenance of Dam. The dam is not maintained. The timber walkway over the spillway has deteriorated such that it is unsafe to walk on, and leakage is occurring around the guideposts. Leakage is also occurring between the stoplogs and between boards of the abandoned slide gates. Stonework is also collapsing from the west training wall upstream of the dam.
- 4.3 Maintenance of Operating Facilities. The sluice gate which controls the only outlet for the dam is in poor condition and may not be operable. The stone side walls of the downstream channel are overgrown with brush. Some stones are missing from the walls, and sections of the west side wall are collapsing.
- 4.4 Description of Any Warning System in Effect. There is no warning system in effect at this dam. However, the offices of the Owner, L&O Realty Trust, are located in the mill complex near the right abutment of the dam.
- 4.5 Evaluation. There is no regular program of inspections or maintenance or any warning system in effect at Mill River Dam. This is extremely undesirable considering the dam is in the "high" hazard category. A program of inspection and maintenance and a surveillance system for this dam should be implemented as recommended in Section 7.3.

MILL RIVER DAM

SECTION 5

HYDRAULIC/HYDROLOGIC

5.1 Evaluation of Features

- a. General. Mill River Dam is a run-of-river type structure with a total drainage area of 41.4 square miles. The drainage area is mostly rural with localized moderate development. There are 12 control structures, mostly dams, located upstream on three main tributaries (see Figure D-1). Mill River Dam is a 120-foot long, ungated spillway and the pond level is controlled by operation of a gated outlet located about 1 mile upstream at Morey's Bridge Dam.

The maximum storage in Mill River Pond is calculated to be 160 acre-feet. At the time of the inspection, the pond was at El 59.4 and water was discharging through the western 21 bays on the spillway.

In March, 1968, a flood occurred, causing Mill River Pond to rise to El 61.4. Upstream at Morey's Bridge Dam, the water level in Lake Sabbatia rose to El 65.6, causing flooding of homes and roads around the lake, and piping of a portion of the embankment. A subsequent study of the hydraulics and stability of both dams concluded that the discharge capacity at Morey's Bridge Dam needed to be increased. As a result, a spillway would also be needed to increase the discharge capacity at Mill River (Whittendon) Dam. An important hydraulic factor is the low head differential (about 2 feet) between the two dams. The Owner has not implemented any of the recommendations in the report. Instead, the slide gates at Mill River Dam were abandoned, their operating mechanisms removed, and the tops cut off. In its present condition, Mill River Dam is used as an overflow weir, with the water level controlled upstream.

- b. Design Data. There are no hydraulic/hydrologic computations available for the design of the

MILL RIVER DAM

spillway at Mill River Dam. Hydraulic analyses in the 1973 study, based on the Kinnison-Colby rare flood, used a peak flood inflow of 1,800 cfs at Mill River Dam. With all the slide gates open, the stoplogs removed, and the sluice gate half open, this flood produced a pond level at El 59.9.

- c. Experience Data. A previous inspection report (see page B-5) states that during the 1955 flood, 1 foot of water was in the cellar of Whittendon Manufacturing Co., located near the east abutment of the dam. It also states that in June, 1967, there was "no pond" and the dam was "lowered". The engineering report dated 1973 states that the maximum pond level was at El 61.4 during the March 1968 storm.
- d. Visual Observations. Water discharges over stoplogs, abandoned slide gates and the sluice gate located in 30 bays on the crest of the spillway. The effective length of the weir is 91 feet, with 21 bays at El 58.9 and nine bays at El 59.6. Water flows over the downstream face of the dam, which slopes at 1:1 to 2:1 and is covered with concrete. Large blocks of rock located at the toe prevent erosion. The channel below the spillway extends 365 feet downstream to Whittendon Street. The channel is 120 feet wide at the spillway and decreases to about 37 feet wide at 240 feet downstream. The vertical side walls are 6 to 11 feet high, and the floor slopes at about 1 percent. About 365 feet downstream, water flows beneath Whittendon Street in two 7-foot by 19.5-foot box culverts with inverts at El 46.0. Below Whittendon Street, water flows in a natural stream bed.

Timbers are deteriorating in the walkway and in the guideposts forming bays on the crest of the spillway. This structure could collapse during a heavy storm. The walkway provides access to the only outlet at the dam, which is a sluice gate. The operating mechanism on the sluice gate is in poor condition and may not be operable. A more detailed discussion of the condition of the dam and appurtenances is presented in Section 3, Visual Inspection.

MILL RIVER DAM

- e. Test Flood Analysis. Based on the Corps of Engineers' guidelines, Mill River Dam has been placed in the "small" size category and the "high" hazard category. Accordingly, a test flood equal to one-half the probable maximum flood (PMF) was used for this analysis.

The test flood inflow for Mill River Dam was estimated to be equal to the test flood outflow from Morey's Bridge Dam. This is due to the delayed effect of the flood from Morey's Bridge Dam, the relatively small drainage area between the dams, and the minor storage available behind Mill River Dam. Because of the flat, swampy character of the watershed, the PMF rate for Morey's Bridge Dam was determined to be 250 cfs per square mile. This calculation is based on the average slope of the drainage area of 0.3 percent, the pond-plus-swamp area to drainage area ratio of 17 percent, and the U.S. Army Corps of Engineers' guide curves for Maximum Probable Flood Peak Rates (dated December, 1977). Applying one-half the PMF to the 41.2 square miles of drainage area upstream of Morey's Bridge Dam, results in a calculated peak flood flow of 5,150 cfs as the test flood inflow. By adjusting the test flood inflow for surcharge storage, the maximum discharge rate was established as 2,460 cfs (60 cfs per square mile) with a water surface at El 69.1. The test flood inflow of 2,460 cfs for Mill River Dam is estimated to be equal to the test flood outflow because of negligible storage behind that dam. The test flood outflow of 2,460 cfs (59 cfs per square mile) will result in a pond level at El 63.1.

Hydraulic analyses indicate that the spillway (with all gates closed and stoplogs in place) can discharge a maximum of 660 cfs with the pond at El 61.1, which is the low point on the east abutment of the dam. This discharge is 27 percent of the test flood outflow. Discharge over the abutments is estimated to be 320 cfs with a maximum head of 2.0 feet. The depth at critical flow would be 1.3 feet with a velocity of 6.1 feet per second. The low level outlet can discharge 148 cfs with the pond at El 58.9 (top of slide gates). The low

MILL RIVER DAM

level outlet can lower the pond by 1 foot, starting from the top of the slide gates, in about two hours.

If all the gates were opened and the stoplogs removed by the time the pond reached El 59.5, the spillway could discharge 2,640 cfs at El 60.8 which is 0.3 feet below the east abutment of the spillway. At the present time, the gates cannot be opened.

- f. Dam Failure Analysis. The peak discharge rate due to failure was calculated to be 4,460 cfs for a 48-foot long section of the spillway. Failure would raise the depth of water at the Whittendon Street Bridge to 14 feet (El 60.0). This would produce flooding of buildings adjacent to the east wall of the downstream channel, and a 1.6-foot high flow over Whittendon Street (see flood impact area shown on Location Map). The bridge embankment would limit the effect of the flood wave farther downstream, although flow through the two 7-foot by 19.5-foot culverts would produce some downstream flooding of thickly developed areas. For this reason, the dam has been placed in the "high" hazard category.

SECTION 6

STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

- a. Visual Observations. The evaluation of the structural stability of Mill River Dam is based on a review of the report dated 1973 on reconstruction of Mill River (Whittendon) Dam, a review of previous inspection reports, and the visual inspection conducted on November 30, 1978.

As discussed in Section 3, Visual Inspection, the dam is in poor condition. The presence of seepage could not be clearly determined, however, a previous inspection report dated 1970 states that several severe leaks were observed at the toe of the dam (see page B-3 in Appendix B). Deterioration of the timber walkway over the spillway is making the access walkway unsafe, causing leaking around the stoplogs and slide gates, and is contributing to the poor condition of the sluice gate.

- b. Design and Construction Data. The dam was originally constructed in 1832, reconstructed in 1882, and reconstructed or repaired again about 1935. The only available data on construction of the dam are presented on a drawing dated 1935 (Figure B-3) and in the report dated 1973, mentioned above. The report includes logs of two borings taken at each abutment of the dam and presents hydraulic and structural analyses of the structure. No other plans, specifications, or computations are available from the Owner, State, or County offices relative to the design and construction of this dam.

Boring logs taken at the site show that the dam is founded on decomposed shale overlying metamorphosed sandstone and shale. A stability analysis discussed in the 1973 report concluded that the flood stage in Mill Pond should be maintained below El 60.5 to insure stability of the dam against sliding.

MILL RIVER DAM

- c. Operating Records. There is no instrumentation of any type in the embankment at Mill River Dam, and no instrumentation was ever installed at this site. The performance of the embankment under prior loading can only be inferred by physical evidence at the site. A previous inspection report (see page B-4 in Appendix B) notes that in July, 1967, the dam was "lowered" and the pond was drained.
- d. Post-Construction Changes. The Owner reports that the dam was "reconstructed" about 40 years ago, however, this was before L&O Realty's ownership. There is a drawing dated 1935 (Figure B-3) indicating proposed replacement of some timbers.

Post-construction changes were performed by the Owner in 1969-1970, after a flood in 1968. These included removal of the operating mechanisms from most of the slide gates, removal of the upper portions of the slide gates and sluice gate to allow discharge over the tops, and placing of unreinforced concrete on the crest and downstream slope of the rockfill base.

There are no as-built drawings available for the dam and no other records of post-construction changes.

- e. Seismic Stability. The dam is located in Seismic Zone No. 2, and in accordance with Phase I "Recommended Guidelines" does not warrant seismic analysis at this time.

SECTION 7

ASSESSMENT, RECOMMENDATIONS, AND REMEDIAL MEASURES

7.1 Dam Assessment

- a. Condition. Based upon a review of available reports and drawings, the visual inspection of the site, and limited operational or maintenance information, there are deficiencies which must be corrected to assure the continued performance of this dam. Generally, the dam is considered to be in poor condition. However, several signs of distress were observed at the site: 23 inoperable slide gates, deterioration of timbers in the walkway on the crest of the spillway, leakage around and between stoplogs and gates on the crest of the spillway, poor condition of the operating mechanism for the sluice gate, overgrowth of brush on both walls of the downstream channel, and collapsing stonework on walls of the downstream channel and on the west training wall upstream of the dam.

Hydraulic analyses indicate that the spillway (with all gates closed and stoplogs in place) can discharge an estimated flow of 660 cfs with the pond at El 61.1, which is the low point on the abutment of the spillway. An outflow test flood (one-half PMF) of 2,460 cfs results in a pond at El 63.1 and will overtop the dam by 2.0 feet. The spillway can discharge 27 percent of the test flood before the dam is overtopped. If all the gates were opened and all stoplogs removed by the time the pond level reached El 59.5, the spillway could discharge 2,460 cfs with the pond at El 60.8, which is 0.3 feet below the east abutment of the spillway. At the present time, the gates cannot be opened.

- b. Adequacy. The lack of detailed design and construction data did not allow for a definitive review. However, a detailed hydraulic report by Metcalf & Eddy, Inc. dated June 13, 1973, was available. Therefore, the evaluation of the adequacy of this dam is based on a review

MILL RIVER DAM

of the June 13, 1973 report, visual inspection, past performance and engineering judgment.

- c. Urgency. The recommendations and remedial measures outlined below should be implemented by the Owner within one year after receipt of this Phase I Inspection Report.
- d. Need for Additional Investigation. Additional investigations to further assess the adequacy of the dam are outlined below in Section 7.2, Recommendations.

7.2 Recommendations. The spillway discharge capacity is not considered adequate. Therefore, further hydrologic and hydraulic studies are required to determine what alternative measures are necessary to significantly increase the discharge capabilities at the dam and reduce the overtopping potential. In view of the concerns over the continued performance of the dam, it is recommended that the Owner employ a qualified consultant to conduct these additional hydraulic/hydrologic studies, including an evaluation of the recommendations outlined in the report by Metcalf & Eddy, Inc. dated June 13, 1973.

Recommendations on repairs and maintenance procedures are outlined below under Section 7.3, Remedial Measures.

7.3 Remedial Measures

- a. Operating and Maintenance Procedures. The dam and appurtenant structures are not maintained. It is recommended that the Owner accomplish the following:
 - (1) immediately remove all of the abandoned slide gates from the spillway and lower the pond to El 55.1. The pond should be maintained at this level until the recommendations and following remedial measures are implemented.
 - (2) restore the abandoned slide gates to operating condition. At the present time, only two of the slide gates have stems, and none have operating mechanisms.

- (3) restore deteriorating timbers in the walkway structure over the spillway,
- (4) restore the sluice gate to operating condition,
- (5) remove brush and small-trees growing on both sides of the downstream channel,
- (6) repair stonework on both walls of the downstream channel and on the west wall upstream of the dam,
- (7) implement a systematic program of maintenance inspections. As a minimum, the inspection program should consist of a monthly inspection of the dam and appurtenances, supplemented by additional inspections during and after severe storms. All repairs and maintenance should be undertaken in accordance with all applicable State regulations.
- (8) periodic technical inspections of this dam should be continued on an annual basis,
- (9) institute a definite plan for surveillance and a warning system during periods of unusually heavy rains and/or runoff.

7.4 Alternatives. An alternative to implementing the recommendations and remedial measures listed above would be to drain the pond and remove the entire dam.

MILL RIVER DAM

APPENDIX A
PERIODIC INSPECTION
CHECKLIST

MILL RIVER DAM

PERIODIC INSPECTION

PARTY ORGANIZATION

PROJECT MILL RIVER

DATE Nov 30 1978

TIME 12:00 - 4:00 PM

WEATHER PARTLY SUNNY

W.S. ELEV. 59.4* U.S. 48.6* DN.S.

*based on assumed benchmark at
El 61.09 on east abutment of dam

PARTY:

- | | |
|----------------------|-----------|
| 1. <u>R. WEBER</u> | 6. _____ |
| 2. <u>C. SWEET</u> | 7. _____ |
| 3. <u>H. LORD</u> | 8. _____ |
| 4. <u>W. CHECCHI</u> | 9. _____ |
| 5. <u>D. COLE</u> | 10. _____ |

PROJECT FEATURE

INSPECTED BY

REMARKS

- | | |
|--------------------|----------------------------|
| 1. <u>DAM</u> | <u>R. WEBER / C. SWEET</u> |
| 2. <u>SPILLWAY</u> | _____ |
| 3. _____ | _____ |
| 4. _____ | _____ |
| 5. _____ | _____ |
| 6. _____ | _____ |
| 7. _____ | _____ |
| 8. _____ | _____ |
| 9. _____ | _____ |
| 10. _____ | _____ |

PERIODIC INSPECTION CHECK LIST

PROJECT MILL RIVER Dam

DATE Nov 30 1978

PROJECT FEATURE Spillway

NAME R. Weber

DISCIPLINE Geotechnical

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - SPILLWAY WEIR, APPROACH AND DISCHARGE CHANNELS</u>	
a. Approach Channel	
General Condition	Fair To Poor, some debris AND LEAVES IN channel
Loose Rock Overhanging Channel	NONE
Trees Overhanging Channel	few small trees
Floor of Approach Channel	submerged
b. Weir and Training Walls	
General Condition of Concrete	dry STONE MASONRY; MISSING IN PLACES good condition IN OTHERS (see below)*
Rust or Staining	NONE
Spalling	NONE
Any Visible Reinforcing	NONE
Any Seepage or Efflorescence	MINOR SEEPAGE THROUGH WALLS IN SOME AREAS
Drain Holes	NONE
c. Discharge Channel	
General Condition	fair
Loose Rock Overhanging Channel	NONE
Trees Overhanging Channel	brush AND TREES UP TO 6 INCHES
Floor of Channel	Large boulders NEAR Spillway TOE
Other Obstructions	NONE, TRAINING WALL LINES channel

* WATER DISCHARGING OVER SPILLWAY DURING INSPECTION
concrete spillway pitted and eroded, flash boards
leaking, OPERATING STRUCTURES MISSING OR
APPARENTLY marginally operable, APPARENT LEAK
BENEATH SPILLWAY

PERIODIC INSPECTION CHECK LIST

PROJECT MILL RIVER DamDATE Nov 30 1978PROJECT FEATURE SpillwayNAME R. WeberDISCIPLINE Geotechnical

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - SERVICE BRIDGE</u>	
a. Super Structure	WOODEN STRUCTURE ROTTED AND IN VERY POOR CONDITION
Bearings	-
Anchor Bolts	-
Bridge Seat	-
Longitudinal Members	TIMBER
Under Side of Deck	fair To poor
Secondary Bracing	poor
Deck	Timber fair To poor
Drainage System	NONE
Railings	Timber poor
Expansion Joints	NONE
Paint	NONE
b. Abutment and Piers	
General Condition of Concrete	TIMBER PIERS VERY POOR CONDITION
Alignment of Abutment	good
Approach to Bridge	blocked AT ONE END OPEN TO PUBLIC AT OTHER
Condition of Seat and Backwall	fair

PERIODIC INSPECTION CHECK LIST

PROJECT MILL RIVERDATE Nov 30 1978PROJECT FEATURE SpillwayNAME R. WeberDISCIPLINE Geotechnical

NAME _____


AREA EVALUATED	CONDITION
<u>OUTLET WORKS - OUTLET STRUCTURE AND OUTLET CHANNEL</u>	
General Condition of Concrete	Poor, Sluice gate appears inoperable *
Rust or Staining	none
Spalling	none
Erosion or Cavitation	heavy erosion of concrete
Visible Reinforcing	none
Any Seepage or Efflorescence	at gate
Condition at Joints	unknown
Drain Holes	unknown
Channel	
Loose Rock or Trees Over- hanging Channel	NONE
Condition of Discharge Channel	fair SAME AS SPILLWAY

* WOOD PLANKS LINE SLUICeway

APPENDIX B
PLAN OF DAMS AND PREVIOUS
INSPECTION REPORTS

	<u>Page</u>
Figure B-1, Plan of Dam from Field Survey, November, 1978	B-1
Figure B-2, Dam Profile, November, 1978	B-2
Figure B-3, Drawing of Repairs to Dam, September, 1935	B-3
Inspection Report for Bristol County Commissioners, July, 1970	B-4
Inspection Report for Bristol County Commissioners, August, 1959	B-5

MILL RIVER DAM

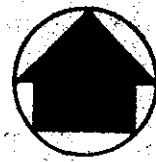

MILL RIVER

WATER SURFACE ELEV. = 59.4

WATER SURFACE
ELEV. = 48.6

BRICK
BLDG.

61.9

61.3

61.2


61.1

49.0 56.7

61.7 50.7

61 x 6

SEEDER
AREA

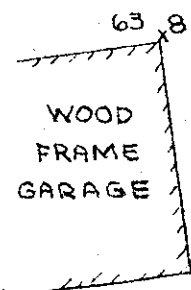

WOOD FENCE
WITH LOCKED
DOOR

CONCRETE
WING WALL


RAILS ON CREST OF SPILLWAY
(SEE FIGURE B-2)

FOOT BRIDGE
TOE OF
APPROXIMATE
DAM

SLUICeway

CONCRETE
WALL

BENCHMARK
SQUARE CUT ON
WALL ELEV. = 61.09




NOTES:

1. ELEVATIONS SHOWN ARE REFERENCED TO TEMPORARY BENCHMARK ELEV. 61.09 (M.S.L.) AS SHOWN ON FEBRUARY 1973 PLAN FIGURE 3, WHITTENTON DAM, PROPOSED ADDITIONS BY METCALF & EDDY, INC.
2. INFORMATION SHOWN BASED ON FIELD SURVEY OF NOVEMBER 30, 1973 AND AFORESAID PLAN
3. #2 INDICATES LOCATION AND DIRECTION OF VIEW FOR PHOTOGRAPHS
4. SEE FIGURE B-2 FOR SECTIONS THROUGH DAM AND ELEVATION VIEW OF CREST OF DAM


METCALF & EDDY, INC.

METCALF & EDDY, INC. ENGINEERS BOSTON, MA.	U.S. ARMY ENGINEER DISTRICT OFFICE CORPS OF ENGINEERS BOSTON, MA.
NATIONAL PROGRAM OF INSPECTION OF NON-FED DAMS	
MILL RIVER DAM	
FIGURE B-1 PLAN OF DAM	
TRIBUTARY TAUNTON RIVER	MASSACHUSETTS
SCALE: 1" = 20'	DATE: JANUARY, 1979

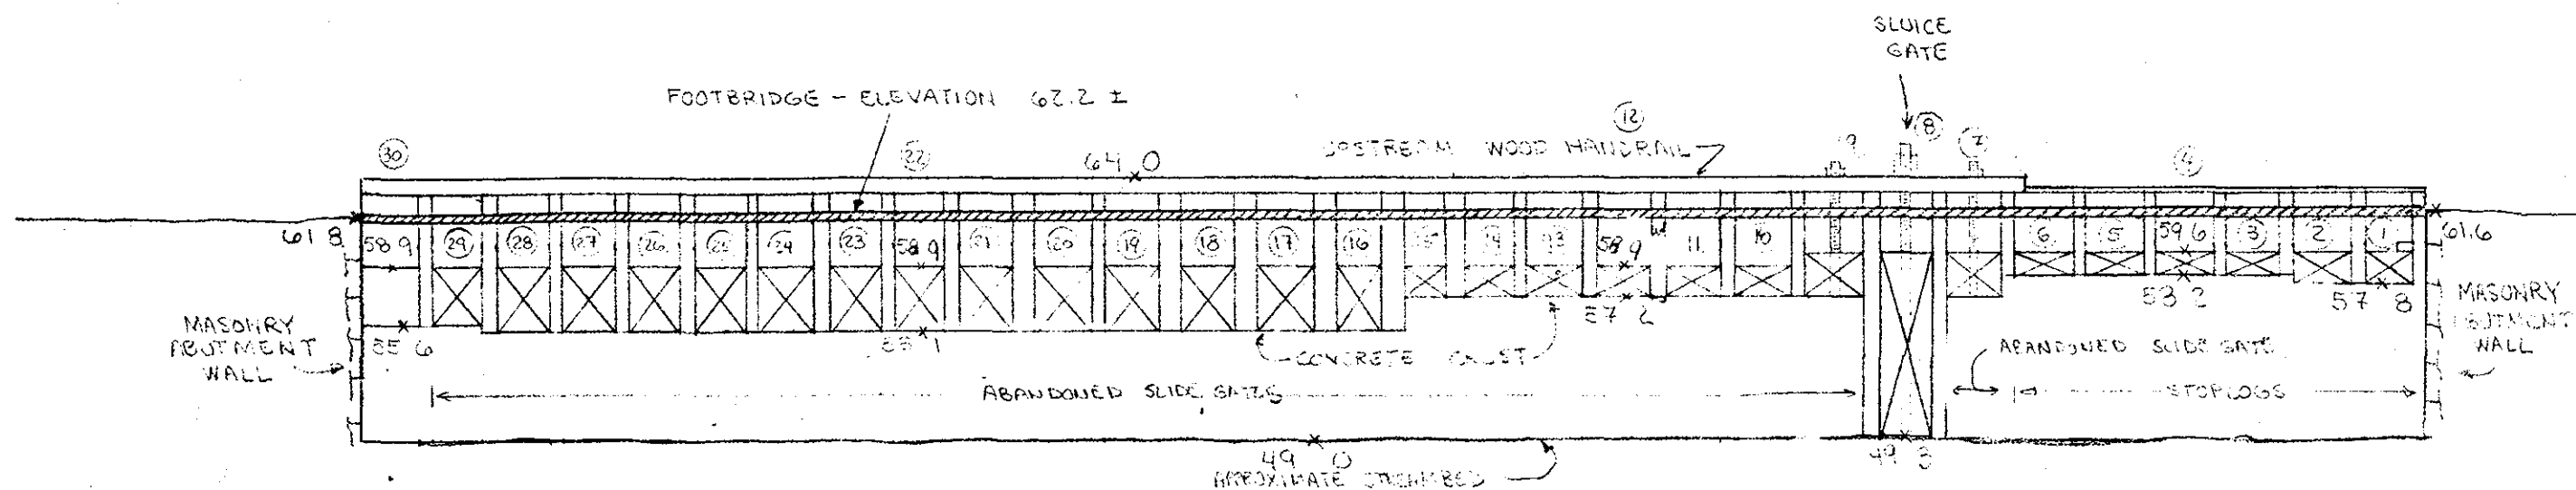


SECTION 3-3
ELEVATION VIEW

NOTE:
⑪ INDICATES BAY NUMBER

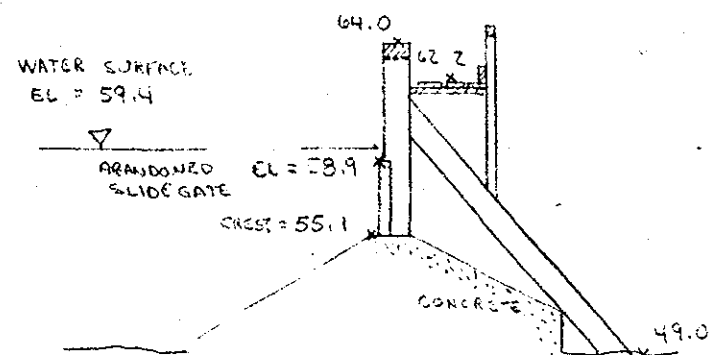


SECTION 1-1

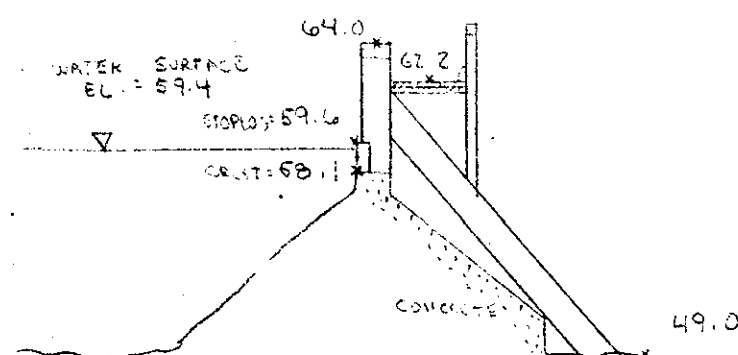

SECTION 2-2

SCALE IN FEET



METCALF & EDDY, INC.

METCALF & EDDY, INC. ENGINEERS BOSTON, MA.	U.S. ARMY ENGINEER DIV. NEW ENGLAND CORPS OF ENGINEERS WALTHAM, MA.
NATIONAL PROGRAM OF INSPECTION OF NON-FED. DAMS	
MILL RIVER DAM	
FIGURE B-2 SECTIONS THROUGH DAM	
TRIBUTARY TAUNTON RIVER	MASSACHUSETTS
SCALE: 1" = 10'	DATE: JANUARY, 1979

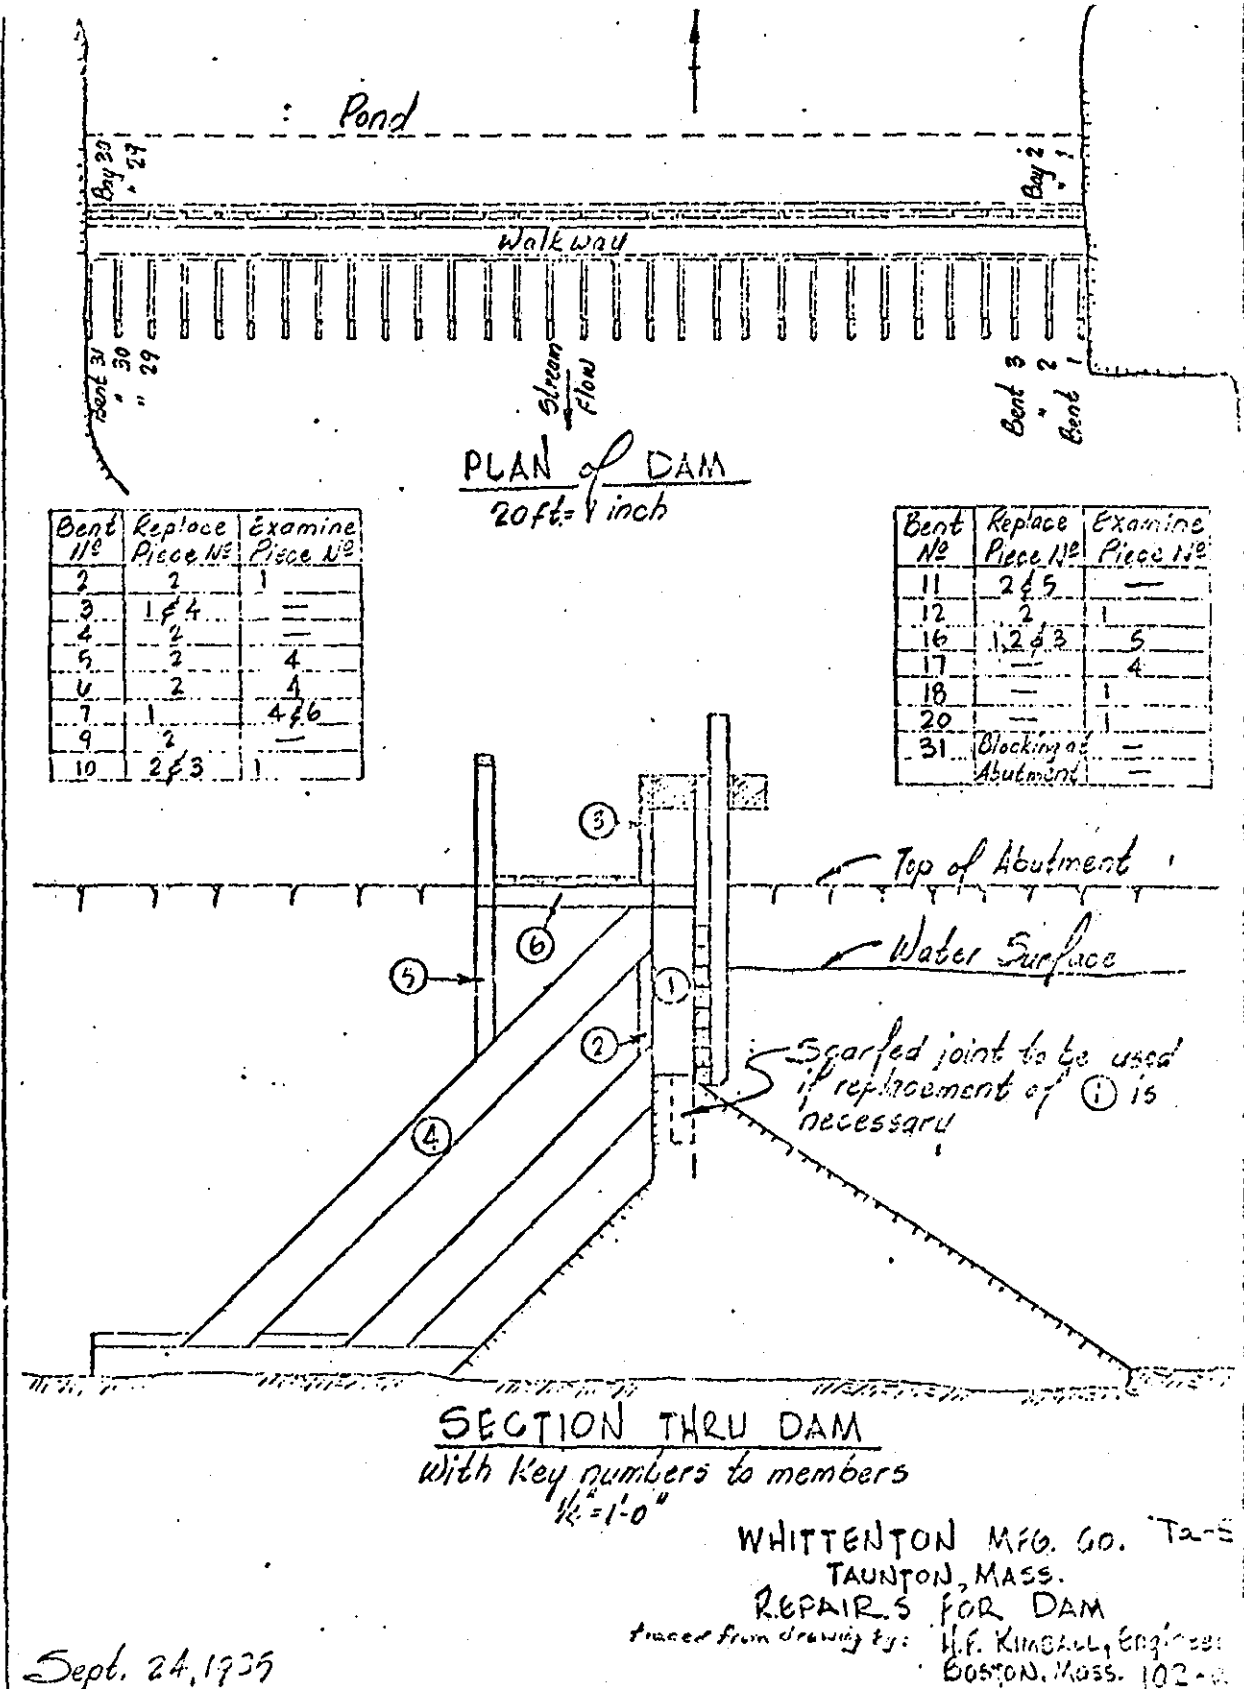


FIGURE B-3

MILL RIVER DAM


BRISTOL COUNTY, MASS.
INSPECTION REPORT FOR DAMS

PREPARED FOR THE BRISTOL COUNTY COMMISSIONERS
BY UNIVERSAL ENGINEERING CORP., BOSTON, MASS.

DAM NO. Ta-5
TOWN: Taunton

INSPECTION DATE	REMARKS & RECOMMENDATIONS
7-23-70	<p>The level of the pond behind the dam is high and there is a moderate flow over the crest. There are presently no stop logs in place, and all 30 sluice gates leak. Two of the three flood gates appear to be sealed off with concrete and there is severe leaking through, around and under the one remaining gate. The timber on all three flood gates is rotted and they are unoperative. There is considerable undermining as evidenced by the several severe leaks at the toe of the dam. The general condition of the dam is poor. The sluice intake located east and upstream of the dam has been abandoned and the inlet channel has been filled in. In order to be effective as a flood control dam, the structure requires complete reconstruction, including the construction of an adequate sluice and gate system for flood flows, and should be properly operated through the sluiceway.</p>

Supplement to original report and data by Heyden, Harding & Buchanan, Inc.	DAM NO. <u>Ta-5</u>
--	---------------------

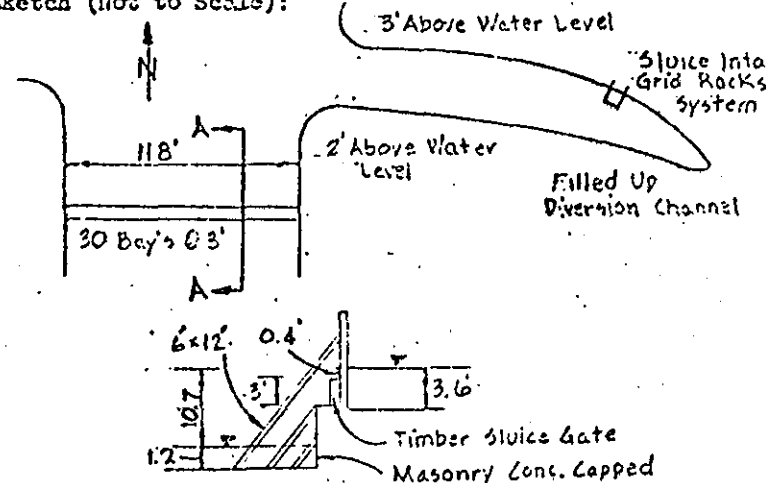BRISTOL COUNTY, MASS.			
INSPECTION REPORT & DATA FOR DAMS			
PREPARED FOR THE BRISTOL COUNTY COMMISSIONERS BY HAYDEN, HARDING & EUCHAMAN, INC., BOSTON, MASS.			
Owner: _____		Whittenton Mfg. Co.	
His Address: _____		(Olken)	
Function of Dam: 750,000,000 gallons annually for			
Location & Access: Whittenton Street			
USGS Quad: Taunton		Lat. 41°55'25" Long. 71°06'25"	
Drainage Area: 33.7 sq. mi.		Ponds: _____ ac.	
Character of R.A.: 1.5 sm water surface, 1.5 s.m.		Res. (dam): _____ ac.	
Estimated Sprinkler system: 2000 gpm with elec. pump &			
Discharge 2000 gpm with steam pumps. Sluiceways Q =			
Capacity: 2800 (1 ft. minimum freeboard)			
General Description of Dam and Discharge Control: (Originally constructed in 1832)			
Buttress dam with 30 manual sluice gates inclusive of one flood gate which reportedly can drain the reservoir in one day, if flow is shut off at the Morays Bridge Dam.			
Sketch (Not to Scale):			
			
Rate Of Annual Replacement: 3 Sluice Gates Plus Any Other Repair.			
Remarks and Recommendations: Should be examined structurally and hydraulically. 6x12's appear okay, but timber supporting lower portion of dam could not be appraised. It is reported to be in poor condition. Overflow capacity may be adequate but should be checked since not more than 2 foot freeboard is available. Recommend opening sluice gates to lower pond level and reduce pressure on dam. Flooding of 1 foot in cellar during 1955 flood. The Whittenton Mfg. Co. owns all water rights above this dam.			
* Change Priority to 1 4-1-68			
Re-inspection	Date	By	Comment
	10-30-61	AAV	Same condition.
	7-8-67	WEL	No Pond. Dam lowered.
	3-20-68	WEL	See memo 4-1-68
			Dam No. Ta-5

** cloth finishing. Water is not polluted but is treated. Also used for fire protection for plant and to city in emergency.

APPENDIX C
PHOTOGRAPHS

MILL RIVER DAM



NO. 1 VIEW OF UPSTREAM FACE OF DAM



NO. 2 VIEW OF OPERATING MECHANISMS FOR SLIDE GATES

MILL RIVER DAM



NO. 3 VIEW OF DOWNSTREAM FACE OF DAM



NO. 4 DETAIL OF DOWNSTREAM FACE OF DAM

MILL RIVER DAM



NO. 5 VIEW OF CHANNEL DOWNSTREAM OF DAM




**NO. 6 VIEW OF DAM AND DOWNSTREAM CHANNEL
FROM WHITTENTON STREET**

MILL RIVER DAM

APPENDIX D
HYDROLOGIC AND HYDRAULIC
COMPUTATIONS

	<u>Page</u>
Figure D-1, Drainage Area Map for Mill River (Whittendon) Dam	D-1
Hydrologic and Hydraulic Computations	D-2

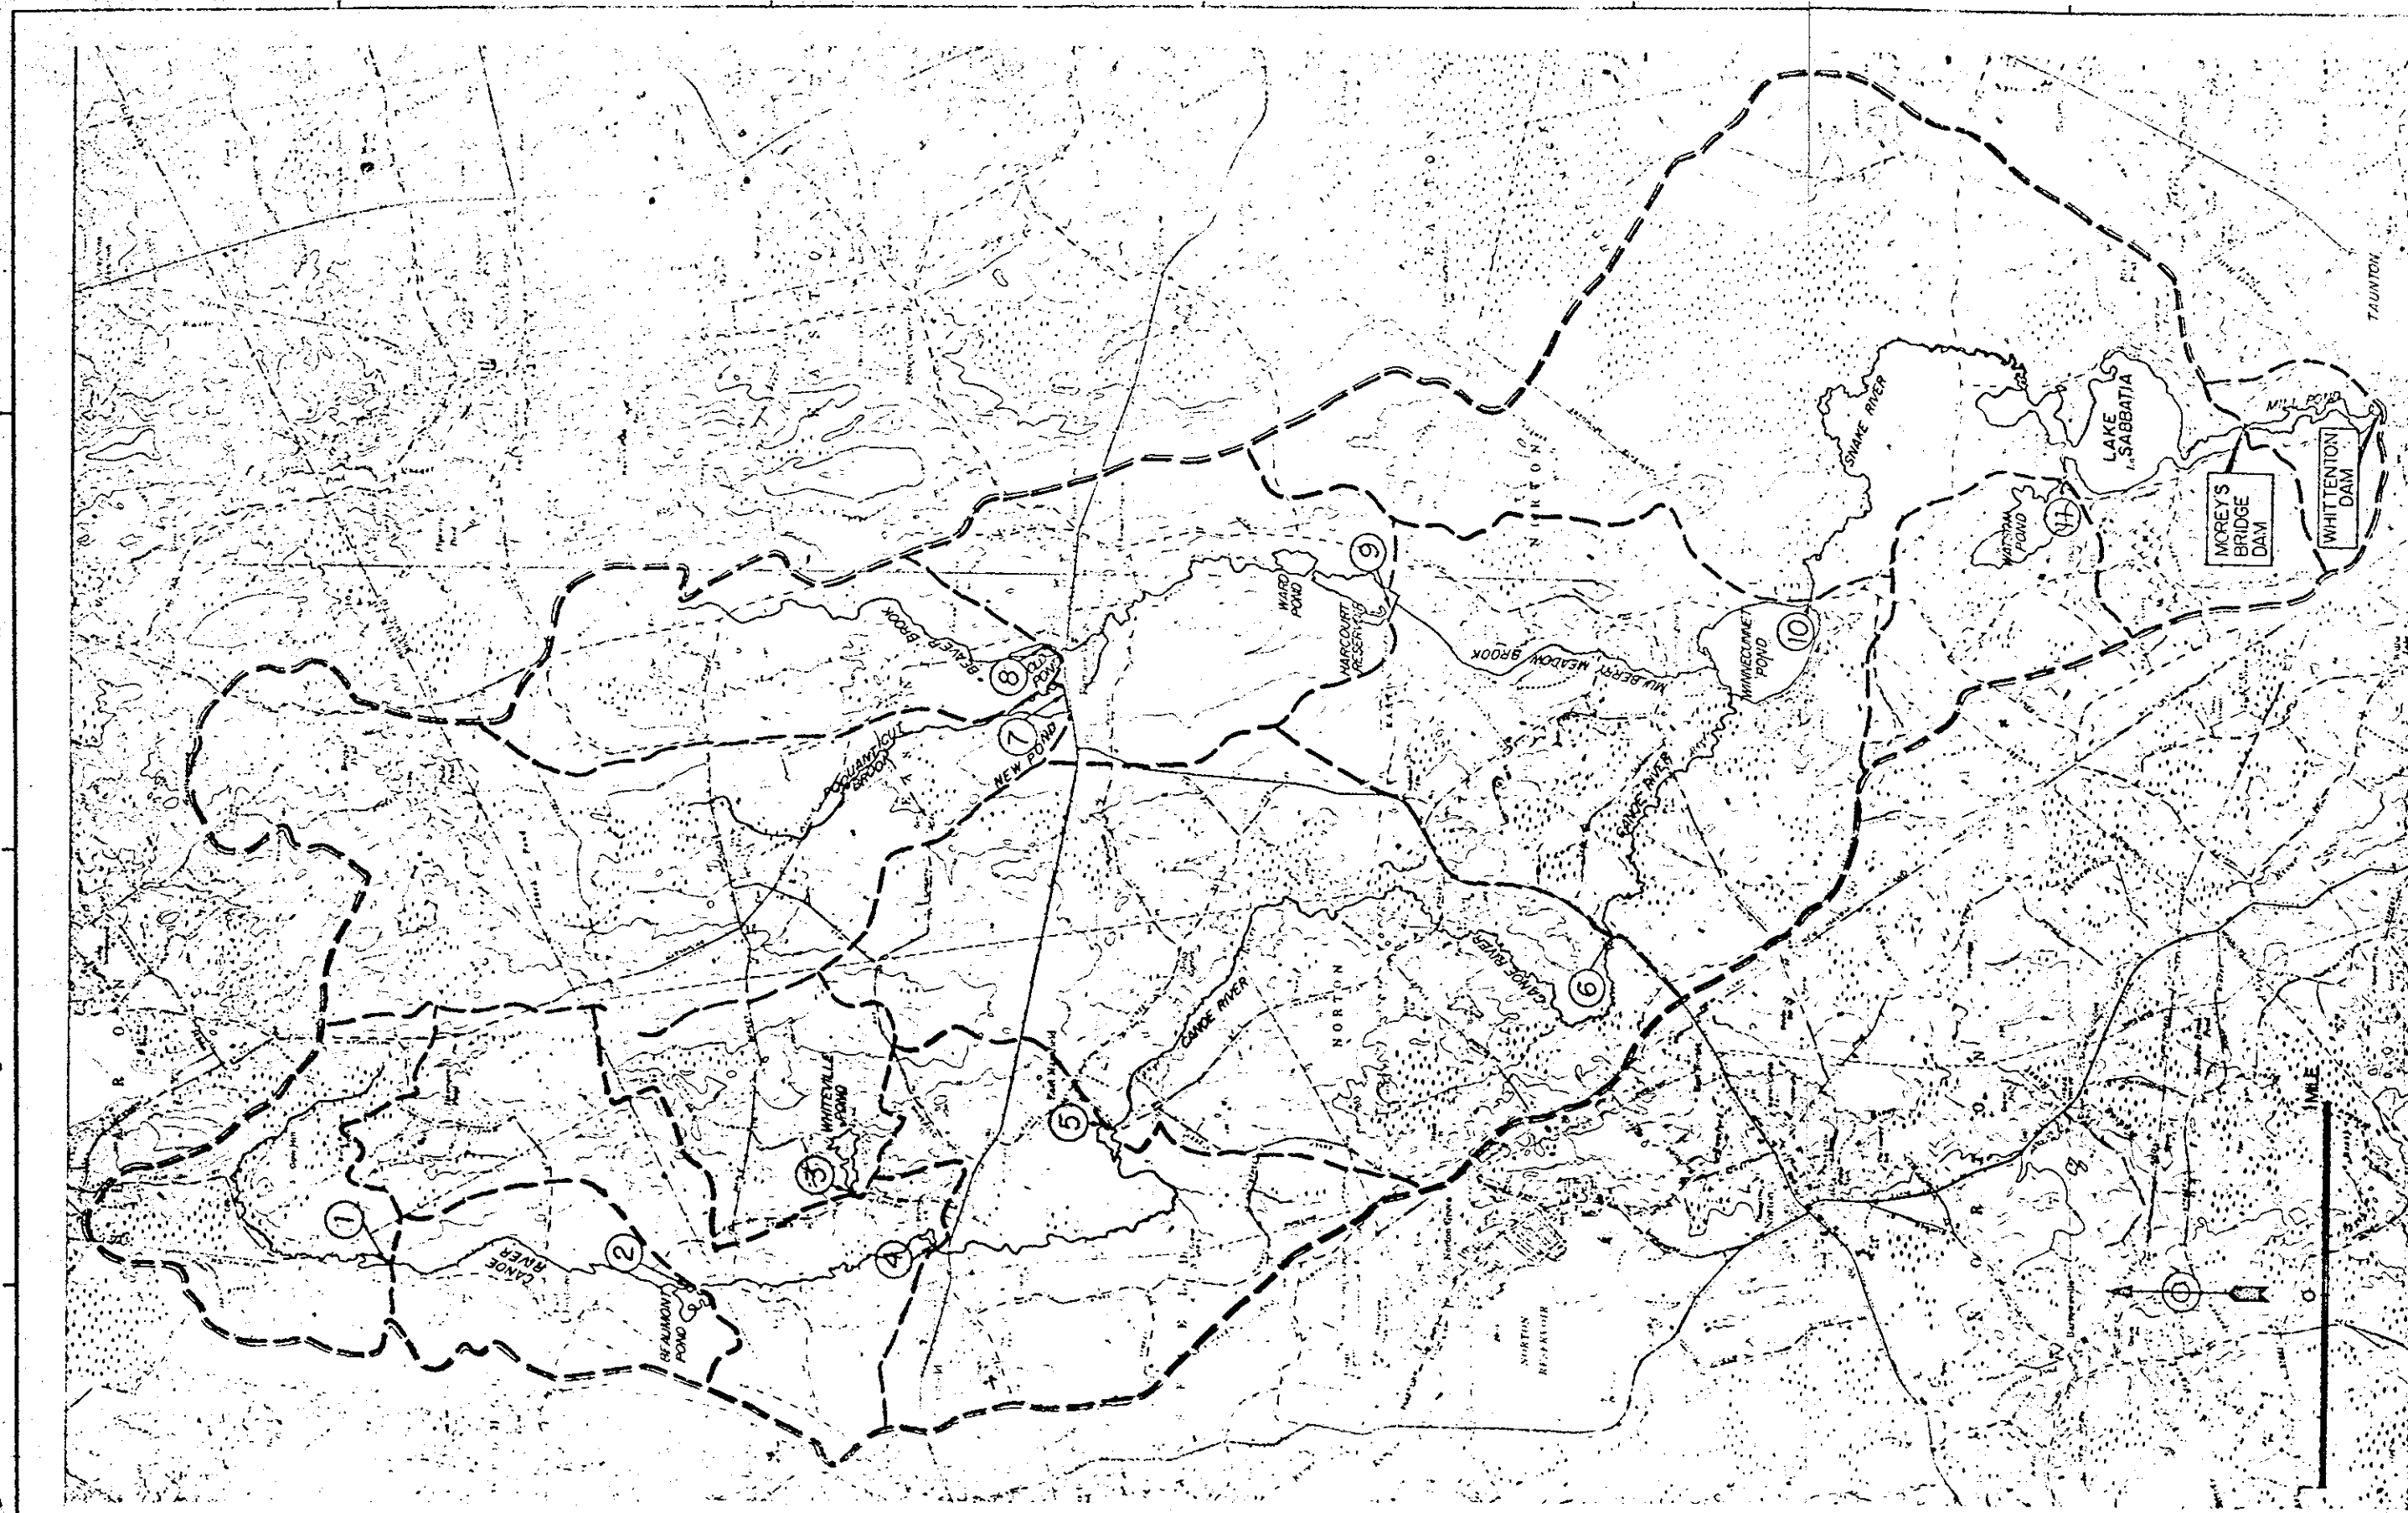

NUMBER _____ DATE _____ MADE BY _____ CHECKED BY _____ REVISIONS _____				MEE METCALF & GORDY, INC. ENGINEERING POSTON - NEW YORK - FORT LAUDERDALE - CHICAGO <i>Gordon E. Thomas</i> 6/11/73 REG. P.E. (MA) NO. 10000		SCALE: 1" = 2000' THE COMMONWEALTH OF MASSACHUSETTS DEPARTMENT OF PUBLIC WORKS FIG. 1 MOREY'S BRIDGE DAM AND WHITTENTON DAM VICINITY MAP AND DRAINAGE AREAS MILL RIVER DAM 1955-1956		JOB NO. 2222 FILE NO. H-58562-1 FIGURE D-1 SHEET _____	
---	--	--	--	--	--	---	--	--	--

I Test Flood & Storage Function - LAKE SABBATIA

1- Total Drainage Area - 41.2 mi²

2- Pond(s) Area: 1.272
 Swamp(s) Area: 5.618
 Total Area Pond(s) & Swamp(s): 6.890

% Ponds & Swamps = $\frac{6.890}{41.2} = 16.7\%$

3- $\frac{350.62}{77700} = 0.0037$ } Say Ave Slope = 0.4%

4- Using C. of E. Curver for Peak Flow Rates & above guide values the Peak Flow Rate was estimated to be well below Flat and Coastal " and taken at 250 c.f.s./mi²
 Size Class: ; Hazard Pot.: ; Spill. Des. Flood:
 Use: Test Flood = $\frac{1}{2}$ PMF - Based on Mill River Dam Criteria

5- Test Flood Inflow = $\frac{1}{2}(250) 41.2 = 5150 \text{ c.f.s.}$

6- Pond Storage - See Sheet 2

~~The pond area is 56 mi. at elev.
 Based on a const. area, storage increases
 at 100 feet per foot of depth increase.~~

~~7- Spillway crest elev. is~~

8- Storage Functions are based on $Q_{out} = Q_{in} [1 - \frac{S_{out}}{R}]$

S_{out} = Storage Vol. in Reservoir related to final Q_{out}
 in terms of inches of rain over the drainage area.

~~$S(\text{in Inches}) = 12 D \left(\frac{Q}{R} \right) =$ D ; $R = 6 \text{ hr rain of storm}$
 $D = \text{Storage depth in feet above spillway crest in reservoir}$~~


9- Storage Functions: (Test Flood & $\frac{1}{2}$ PMF - if needed)

$F'_{TF} = 5150 - 542 S$	$S =$	$-$	D
$F'_{\frac{1}{2} PMF} =$	$S =$	$-$	D

II Lake Sabbatia Discharge

Disch. - Storage Ratings from: Rept to Mass. D.P.W. on "Dams - Taunton Mass." June 1973

Pond El	64	65	66	67	68	69	70	
Disch	1130	1460	1720	1960	2080	(2400)	(3900)	} Extrapolated
Stor. - ac. ft.	1340	2658	4084	5847	7936	(10600)	(13300)	
Stor. - S'	0.61	1.21	1.86	2.66	3.61	4.82	6.05	
542 S'	331	656	1008	1442	1957	2612	3279	
5150-542 S'	4819	4494	4142	3708	3193	2538	1870	= F'_{TF}

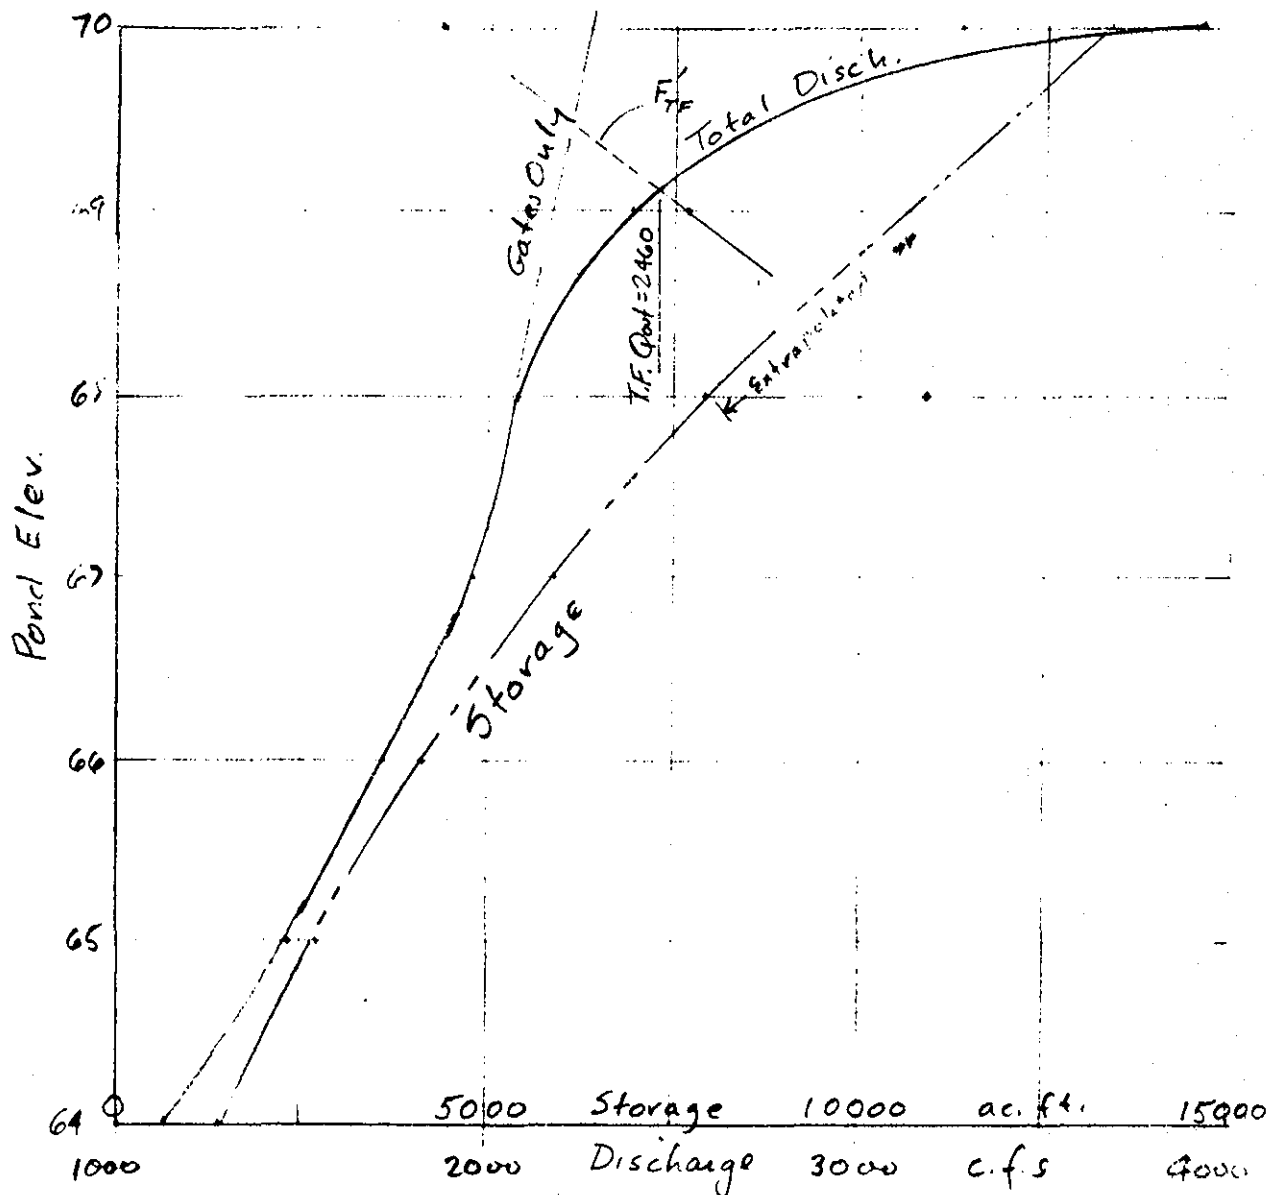



Discharge Ratings

A - Spillway

The spillway is the crests of 20 stoplogs at varying elevations

Width: $120' - 29(12''\text{-timbers}) = 91.0'$

Width of Each stoplog ditch: $\frac{91}{30} = 3.03'$ (4 per bay)

Contraction allowance: $(2\text{ contr})(0.1)2' = 0.4'$ [Ave Hd $\approx 2'$]

Crest Elevations: 9 bays @ elev. $59.59 \pm \approx 59.61$ in Q₃
 12 bays @ elev. $59.2 \pm$ in Q₂
 9 bays @ elev. $58.96 \pm \approx 58.95$ in Q₁

Use Williams & Hager "Hydraulic Tables" w/ $p_0 = 3.0$ & $L = 2.6'$ each bay

Pond Elev	59.5	60.0	60.5	61.0	62.0	63.0	64.0	65.0
Q ₁	40	90	160	230	420	640	890	1140
Q ₂	20	70	150	250	480	760	1080	1440
Q ₃	—	20	70	130	280	480	710	970
ΣQ_s	60	180	380	610	1180	1880	2680	3550

B - Crest Flow

Broad Crest Weir - say $q = 2.55 H_c^{1.5}$
 [Ref. : V.T. Chow "Open Chan. Hydr." pg 52]


Pond EL.	62	63	64	65	66
30' @ 61	80	220	400	610	
40' @ 62	—	100	290	530	
40' @ 63	—	—	100	290	
ΣQ_c	80	320	790	1430	

III Discharge Ratings - Cont.

C - Whittenton St. Bridge

Bridge opening constricted by beam under roadway
 Clear opening: 2 @ 7.1' Hi by 19.5' Wide
 Assume Ent. Control. Ref: V.T. Chow "Open Chan. Hydr." pg 498
 Inv. El. 45.9

H/d	1.0	1.25	1.5	2	3
g	60	77	92	115	150
Q_B	2340	3000	3590	4490	5850
El. Water	53.0	54.8	56.6	60.1	67.2
Depth	7.1	8.9	10.7	14.2	21.3

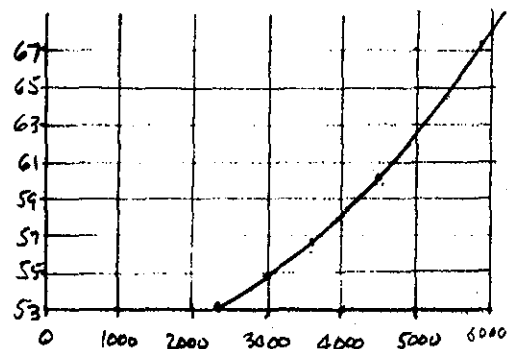

D - Dam to Bridge Channel

Min. Width - 37'; Rect. $\therefore R \approx y$; $S_o = \frac{47.8 - 45.9}{220} = .0086$, $\sqrt{S_o} = .0929$

$n \approx 0.04 \therefore V = 3.462 y^{2/3}$

y	5	10	15
A	185	370	555
V	10.1	16.1	21.1
Q	1870	5950	11700
El. Water @ Bridge	50.9	55.9	60.9

By Insp., Bridge Controls"
 upstr. levels, not
 channel (see "C")

E - Flow over Whittenton St.

Broad crest weir flow - say, $q = 2.55 H_w^{1.5}$
 [Ref. V.T. Chow, "Open Chan. Hydr." pg 52]

Water El.	59	60	61	62	63
40' @ 58.2	70	250	480	760	1070
10' @ 60.6	—	—	10	40	90
10' @ 61.6	—	—	—	10	40
70' @ 62	—	—	—	—	180
ΣQ_w	70	250	490	810	1380
Add Q_B	4250	4480	4700	4850	5100
Total	4320	4730	5190	5660	6480

III Discharge Ratings - Cont.

F- Spillway Flow w/ Stoplogs Removed

Ave. Hydr. width of each bay = 2.6' - after contraction - see "A"

Use W. & H. "Hydr. Tables" - $w/y = 30$ & Shape Coef. = 0.95

Conc. Crest Elevations: 13 bays @ el. 55.1 } say 14 @ 55.1 for Q_1
 1 bay @ el. 55.6 }
 Note: Bay w/ low level gate would have no flow if crest flow if gate is raised 8 bays @ el. 57.2 } say 10 @ 57.3 for Q_2
 2 bays @ el. 57.8 }
 4 bays @ el. 58.2 } say 5 @ 58.3 for Q_3
 1 bay @ el. 58.9 }

Pond El.	57	58	59	60	61	62
Q_1	300	560	880	1240	1640	2050
Q_2	—	70	180	360	580	830
Q_3	—	—	80	90	180	290
ΣQ_F	300	630	1090	1690	2400	3170
Add Q_L	140	140	150	160	170	170
Add Q_c	—	—	—	—	—	80
Tot. Q	440	770	1240	1850	2570	3420

III Discharge Relations - cont.

G- Low Level Outlet

Sluice Gate - 3' wide x 3.9' max ht., Inv. El. 49.33 - Say 49.3
 Assume Pond El. = 59.0

Ref.: V.T. Chow, "Open Chan. Hydr." pg 508, 509

$$Q_L = C L h \sqrt{2gy_1} \quad ; \text{ Free Disch.: } C = 0.52 \quad ; \quad \frac{y_1}{h} = \frac{9.7}{3.9} = 2.5$$

$$Q_L = 0.52 (3) 3.9 \sqrt{64.4 (9.7)} = 152 \text{ cfs.} \quad \left. \begin{array}{l} \\ \end{array} \right\} \text{ Ave } 148 \text{ cfs}$$

$$\text{w/ Pond @ El. } 58.0, Q_L' = 144 \text{ cfs}$$

$$\text{Time to lower Pond 1 foot} = \frac{23.4 (43560)}{148 (3600)} = \underline{\underline{\pm 1.9 \text{ hours}}}$$

$$\text{Use in "F": } Q_L = 48.8 \sqrt{y_1} \quad ; \quad y_1 = \text{Pond El.} - \text{El. } 49.3$$

IV Abutment Discharge

T.F. Outflow Pond El.: 63.1

L.P. Abutment

61.1

2.0 Head.

$$g_A = 2.55 (2.0)^{1.5} = 7.2 \text{ cfs/ft.}$$

As Critical Flow: $y_c = 1.2 \text{ ft.}$

$$V_c = 6.1 \text{ fps}$$

Project Nat. Review of Non Fed Dams Acct. No. 6191 Page 7 of 9
Subject Bristol County, Mass. Comptd. By LEB Date 2/7/79
Detail MILL RIVER DAM Ck'd. By MBJ Date 2/15/79

⑤ Mill River Dam Pond

Size: Small ; Hazard: High ; Test Flood : $\frac{1}{2}$ PMF


Peak inflow from Lake Sabbatia is 2460 c.f.s. for test flood conditions.

Incremental tributary area between Lake Sabbatia and Mill River Dam is ± 0.2 mi².

Peak flow from incremental area should occur a number of hours before the peak flow from Lake Sabbatia.

Storage behind Mill River Dam is minimal.

\therefore Omit storage reduction & added flow from incremental area. Assume Test Flood outflow at Mill River Dam \approx Outflow from Lake Sabbatia which equals 2460 c.f.s.

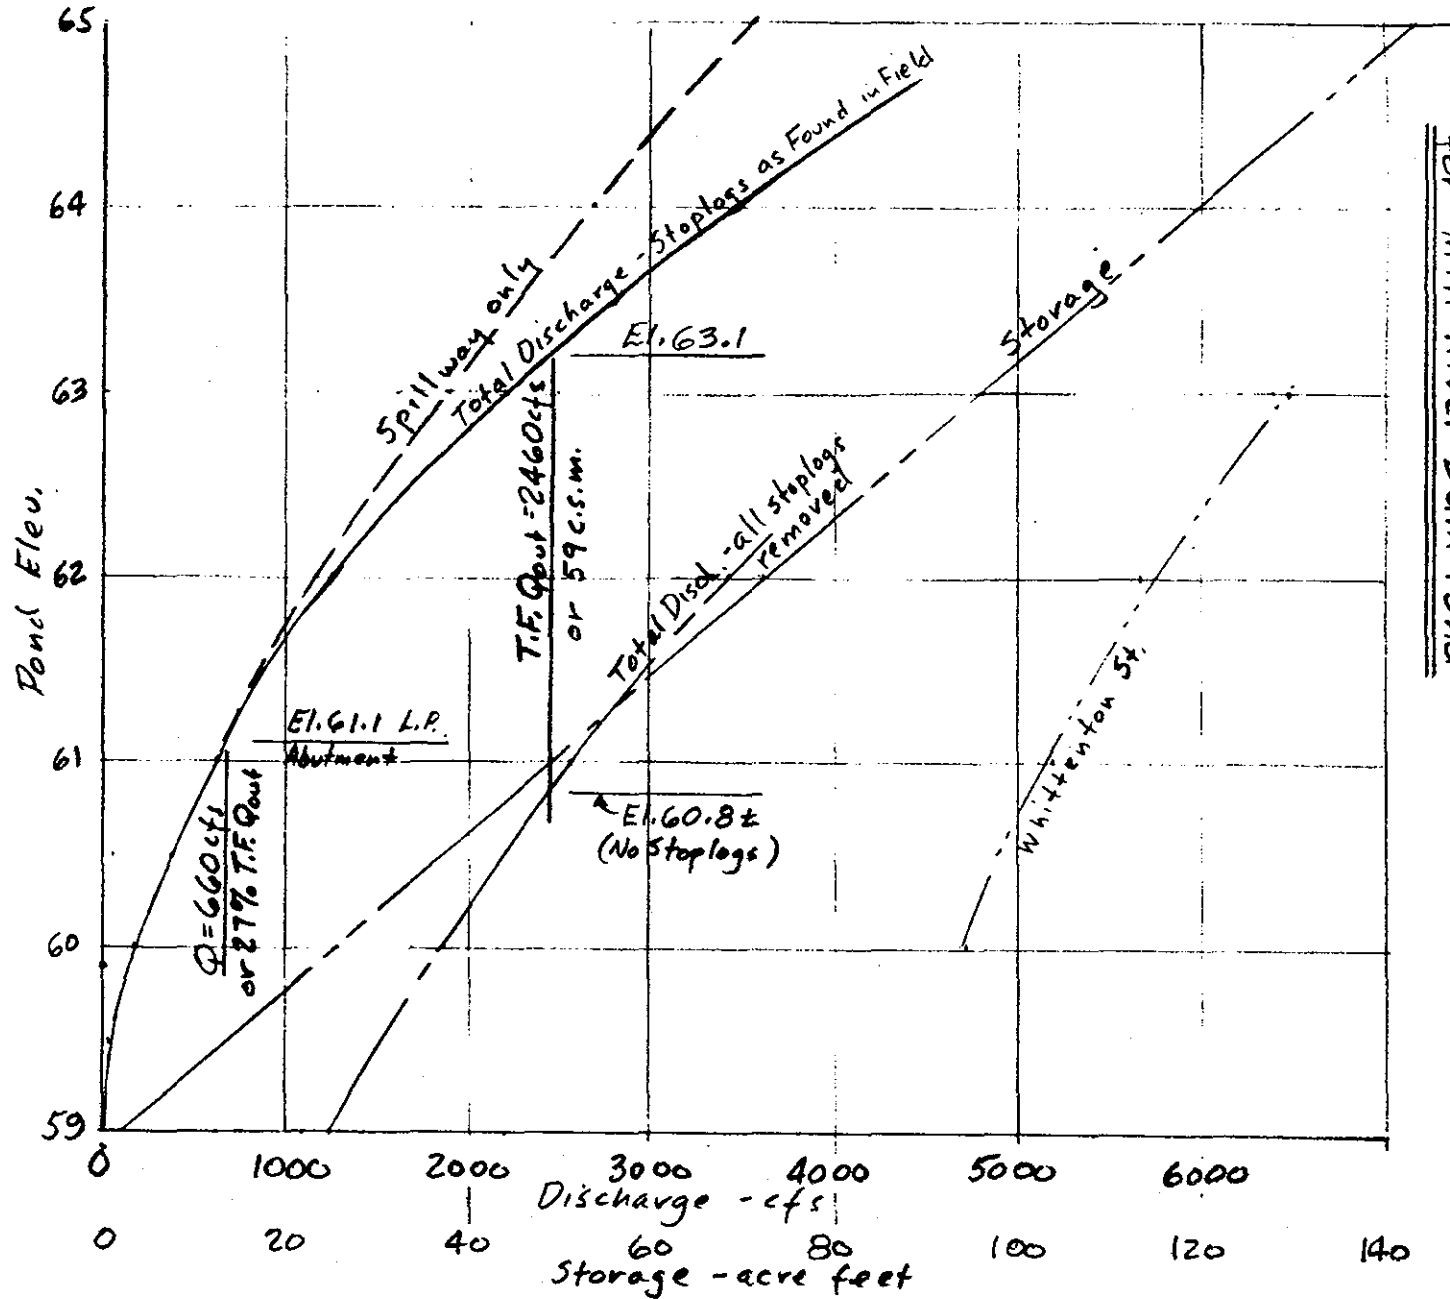

Project Net. Review of New Fed. Dams Acct. No. 6191 Page 8 of 9
 Subject Bristol County, Mass. Compd. By LSE Date 1/11/79
 Detail MILL RIVER DAM Ckd. By MBD Date 1/23/79



Failure of Dam

Peak Failure Flow:

Pond Elevation - 61± Top of Side Wall

Toe Elevation - 48±

$$Y_0 = 13±$$

Dam Length Subject to Breaching = 120'

$$W_0 = 40\%(120) = 48$$

$$Q_R = 1.68 W_0 (Y_0)^{1.5} = 1.68(48)(13)^{1.5} = 3800 \text{ cfs.}$$

Disch. @ Pond @ El. 61± = 660 cfs ∴ Tot. Failure Q = 4460 cfs

Storage Volume Released:

Storage Above Spillway (61-57±) 23.4 = 47 ac. ft


Storage Below Spillway $\frac{1}{3}(11)$ 23.4 = 86

S = Total Storage = 133 ac ft

Bridge Hydraulics:

Same as III C.

H/A	0.3	0.5	0.7	0.9
q	9.5	21	36	51
Q_B	370	820	1400	1990
Depth	2.1	3.6	5.0	6.4
Elev. @ Bridge	48	49.5	50.9	52.3

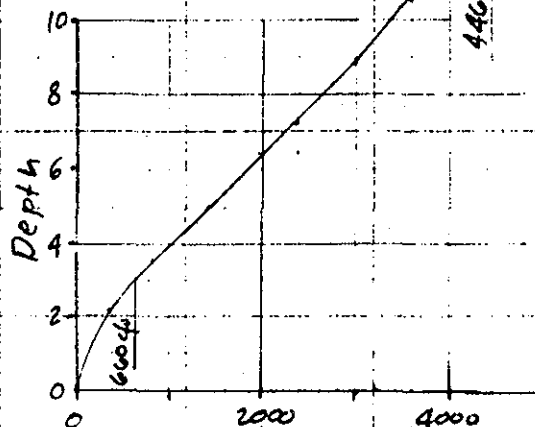

Failure under above test conditions raises depth at bridge from ± 3' to ± 14', with a minor flow over Whittenton St. 14 ft depth @ bridge equals elev. ± 60, which is only one foot below the assumed level in the pond. The street embankment would act as a secondary dam, limiting discharge downstream.

Time to Drain:

$$\frac{43560 (133)}{3600 (\frac{1}{2}) (3800)} = 0.85 \text{ Hours, or } 51 \text{ minutes}$$

APPENDIX E

INFORMATION AS CONTAINED IN THE
NATIONAL INVENTORY OF DAMS

MILL RIVER DAM



INVENTORY OF DAMS IN THE UNITED STATES

STATE	IDENTITY NUMBER	DIVISION	STATE	COUNTY	CONGR. DIST.	STATE	COUNTY	CONGR. DIST.	NAME	LATITUDE (NORTH)	LONGITUDE (WEST)	REPORT DATE DAY MO YR
MA	013	NED	MA	005	10				MILL RIVER DAM	4155.4	7106.4	16FE879

POPULAR NAME	NAME OF IMPOUNDMENT

REGION	BASIN	RIVER OR STREAM	NEAREST DOWNSTREAM CITY-TOWN-VILLAGE	DIST FROM DAM (MI.)	POPULATION
01	06	MILL RIVER	TAUNTON	0	42100

TYPE OF DAM	YEAR COMPLETED	PURPOSES	STRUCTURAL HEIGHT (FT.)	HYDRAULIC HEIGHT (FT.)	IMPOUNDING CAPACITIES MAXIMUM (ACRE-FT.)	NORMAL (ACRE-FT.)
ERCIPG	1832	S	12	12	160	115

DIST OWN FED R PRV/FED SCS A VER/DATE

NED N N N N

REMARKS

D/S	SPILLWAY	MAXIMUM DISCHARGE (FT.)	VOLUME OF DAM (CY)	POWER CAPACITY	NAVIGATION LOCKS
HAS	CREST LENGTH TYPE WIDTH (FT.)			INSTALLED (MW) PROPOSED (MW)	NO LENGTH WIDTH LENGTH WIDTH LENGTH WIDTH LENGTH WIDTH
1	120 U 91	660	450		

OWNER	ENGINEERING BY	CONSTRUCTION BY
L & O REALTY TRUST CO	UNKNOWN	UNKNOWN

DESIGN	CONSTRUCTION	OPERATION	MAINTENANCE
NONE	NONE	NONE	NONE

INSPECTION BY	INSPECTION DATE DAY MO YR	AUTHORITY FOR INSPECTION
METCALF AND EDDY INC	30NOV78	PUBLIC LAW 92-367

REMARKS